



## ASSEMBLY INSTRUCTIONS FOR T3-46T08-LD PIN & T3-47T08-LD SOCKET TWINAX CONTACTS

FIG.1

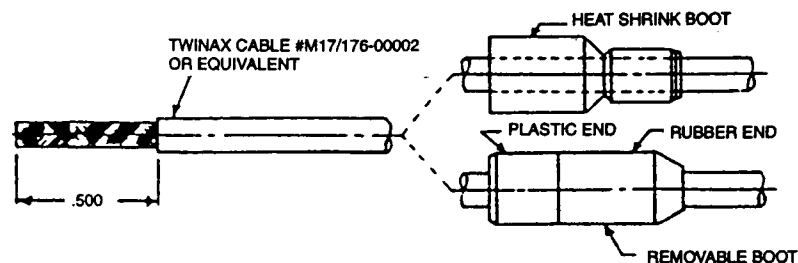


1. SLIDE HEAT SHRINK BOOT (SUPPLIED WITH CONTACT) OR REMOVABLE BOOT (SUPPLIED WITH CONNECTOR) ONTO CABLE AS SHOWN. DISCARD HEAT SHRINK BOOT WHEN USING REMOVABLE BOOT.
2. STRIP OUTER JACKET TO DIMENSION SHOWN (.500). MAKE CUT SQUARE AND SHARP, BEING CAREFUL NOT TO NICK BRAID.

FIG.2

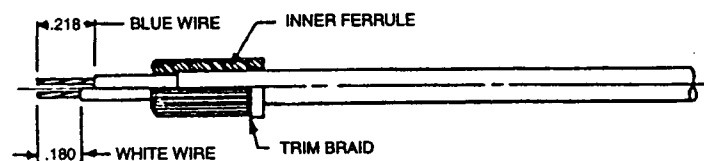

1. SLIDE INNER FERRULE OVER BRAID UNTIL OUTER JACKET TOUCHES INNER SHOULDER OF FERRULE.
2. COMB OUT BRAID AND FOLD BRAID BACK OVER INNER FERRULE. TRIM EXCESS BRAID EVEN WITH SHOULDER.
3. STRIP INNER WIRES AS SHOWN (.218 BLUE WIRE & .180 WHITE WIRE). MAKE CUTS SQUARE AND SHARP, BEING CAREFUL NOT TO NICK CONDUCTORS.


FIG.3

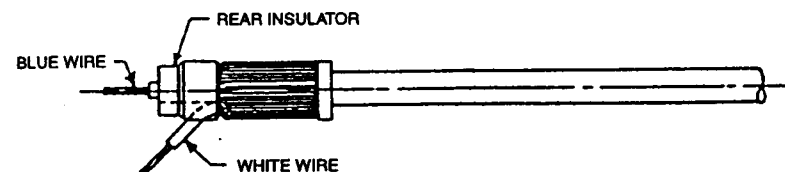

1. BEND WHITE WIRE OUTWARD AND INSTALL BLUE WIRE THRU CENTER HOLE OF REAR INSULATOR.

TABLE I

|                   | CENTER CONTACT TOOLING |                    | INTERMEDIATE CONTACT TOOLING |                 | OUTER CRIMP SLEEVE TOOLING |                 |
|-------------------|------------------------|--------------------|------------------------------|-----------------|----------------------------|-----------------|
|                   | Basic Crimping Tool    | Contact Positioner | Basic Crimping Tool          | Die Part Number | Basic Crimping Tool        | Die Part Number |
| Military Part No. | M22520/2-01            | None               | M22520/5-01                  | None            | M22520/5-01                | None            |
| Daniels Part No.  |                        | K709               |                              | Y631            |                            | Y631            |

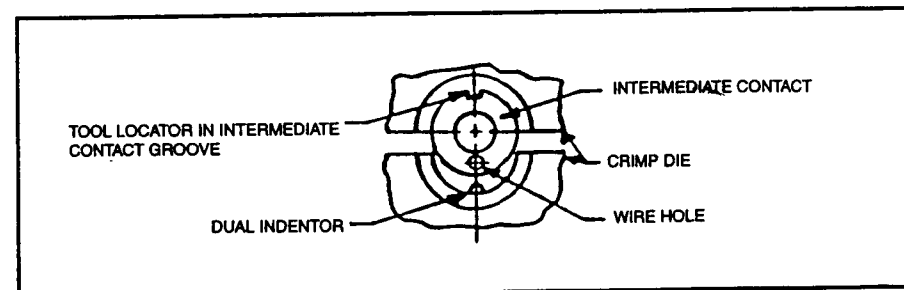

(Pyle-National) Form No. PN-430 3/94


**AMPHENOL CORPORATION**  
**Amphenol Aerospace**  
 607-563-5011  
 40-60 Delaware Avenue  
 Sidney, New York 13838-1395

FIG 4A



1. SLIDE CENTER PIN CONTACT OVER CONDUCTOR OF BLUE WIRE. CONDUCTOR MUST BE VISIBLE THROUGH THE WIRE INSPECTION HOLE. CONTACT MUST BUTT REAR INSULATOR AND REAR INSULATOR MUST BUTT INNER FERRULE.
2. CRIMP CENTER PIN CONTACT TO BLUE WIRE USING CRIMP TOOL AND CONTACT POSITIONER AS SHOWN IN TABLE I.

FIG 5A

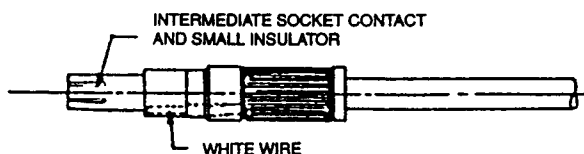

1. SLIDE INTERMEDIATE SOCKET CONTACT AND SMALL INSULATOR SUB-ASSEMBLY OVER CENTER PIN CONTACT.
2. INSERT WHITE WIRE INTO HOLE ON REAR SURFACE OF INTERMEDIATE CONTACT. CONDUCTOR MUST BE VISIBLE THROUGH THE WIRE INSPECTION HOLE. INTERMEDIATE CONTACT MUST BUTT THE REAR INSULATOR.
3. CRIMP THE INTERMEDIATE CONTACT TO THE WHITE WIRE USING CRIMP TOOL AND CRIMP DIE AS SHOWN IN TABLE I.

FIG 6A




1. SLIDE OUTER PIN BODY AND LARGE INSULATOR SUB-ASSEMBLY OVER INTERMEDIATE SOCKET CONTACT UNTIL FULLY BOTTOMED.
2. WITH ASSEMBLY FULLY BOTTOMED, HEX CRIMP REAR PORTION OF OUTER BODY WITH CRIMPING TOOL AND CRIMP DIE AS SHOWN IN TABLE I. AFTER CRIMPING, CENTER PIN CONTACT MUST BE LOCATED WITHIN DIMENSIONS SHOWN.
- 3A. SLIDE HEAT SHRINK BOOT OVER CRIMPED PORTION OF CONTACT AND APPLY HEAT TO SHRINK BOOT ONTO CONTACT AND CABLE.
- 3B. AFTER INSERTION OF TWINAX CONTACT INTO CONNECTOR, SLIDE THE REMOVABLE BOOT OVER THE CONTACT AND INTO THE CONTACT CAVITY UNTIL FIRMLY SEATED.

FIG 4B



1. SLIDE CENTER SOCKET CONTACT OVER CONDUCTOR OF BLUE WIRE. CONDUCTOR MUST BE VISIBLE THROUGH THE WIRE INSPECTION HOLE. CONTACT MUST BUTT REAR INSULATOR AND REAR INSULATOR MUST BUTT INNER FERRULE.
2. CRIMP CENTER SOCKET CONTACT TO BLUE WIRE USING CRIMP TOOL AND CONTACT POSITIONER AS SHOWN IN TABLE I.

FIG 5B

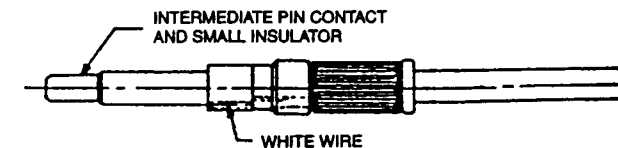

1. SLIDE INTERMEDIATE PIN CONTACT AND SMALL INSULATOR SUB-ASSEMBLY OVER CENTER SOCKET CONTACT.
2. INSERT WHITE WIRE INTO HOLE ON REAR SURFACE OF INTERMEDIATE CONTACT. CONDUCTOR MUST BE VISIBLE THROUGH THE WIRE INSPECTION HOLE. INTERMEDIATE CONTACT MUST BUTT THE REAR INSULATOR.
3. CRIMP THE INTERMEDIATE CONTACT TO THE WHITE WIRE USING CRIMP TOOL AND CRIMP DIE AS SHOWN IN TABLE I.

FIG 6B



1. SLIDE OUTER SOCKET BODY AND LARGE INSULATOR SUB-ASSEMBLY OVER INTERMEDIATE PIN CONTACT UNTIL FULLY BOTTOMED.
2. WITH ASSEMBLY FULLY BOTTOMED, HEX CRIMP REAR PORTION OF OUTER BODY WITH CRIMPING TOOL AND CRIMP DIE AS SHOWN IN TABLE I. AFTER CRIMPING, INTERMEDIATE PIN CONTACT MUST BE LOCATED WITHIN DIMENSIONS SHOWN.
- 3A. SLIDE HEAT SHRINK BOOT OVER CRIMPED PORTION OF CONTACT AND APPLY HEAT TO SHRINK BOOT ONTO CONTACT AND CABLE.
- 3B. AFTER INSERTION OF TWINAX CONTACT INTO CONNECTOR, SLIDE THE REMOVABLE BOOT OVER THE CONTACT AND INTO THE CONTACT CAVITY UNTIL FIRMLY SEATED.

## Данный компонент на территории Российской Федерации

**Вы можете приобрести в компании MosChip.**

Для оперативного оформления запроса Вам необходимо перейти по данной ссылке:

<http://moschip.ru/get-element>

Вы можете разместить у нас заказ для любого Вашего проекта, будь то серийное производство или разработка единичного прибора.

В нашем ассортименте представлены ведущие мировые производители активных и пассивных электронных компонентов.

Нашей специализацией является поставка электронной компонентной базы двойного назначения, продукции таких производителей как XILINX, Intel (ex.ALTERA), Vicor, Microchip, Texas Instruments, Analog Devices, Mini-Circuits, Amphenol, Glenair.

Сотрудничество с глобальными дистрибьюторами электронных компонентов, предоставляет возможность заказывать и получать с международных складов практически любой перечень компонентов в оптимальные для Вас сроки.

На всех этапах разработки и производства наши партнеры могут получить квалифицированную поддержку опытных инженеров.

Система менеджмента качества компании отвечает требованиям в соответствии с ГОСТ Р ИСО 9001, ГОСТ РВ 0015-002 и ЭС РД 009

### Офис по работе с юридическими лицами:

105318, г.Москва, ул.Щербаковская д.3, офис 1107, 1118, ДЦ «Щербаковский»

Телефон: +7 495 668-12-70 (многоканальный)

Факс: +7 495 668-12-70 (доб.304)

E-mail: [info@moschip.ru](mailto:info@moschip.ru)

Skype отдела продаж:

moschip.ru

moschip.ru\_4

moschip.ru\_6

moschip.ru\_9