



Six Degrees of Freedom Sensor

Silicon Anomaly

ADIS16364

ADIS16364 ANOMALIES

This anomaly list describes the known bugs, anomalies, and workarounds for the ADIS16364.

Analog Devices, Inc., is committed, through future silicon revisions, to continuously improve silicon functionality. Analog Devices tries to ensure that these future silicon revisions remain compatible with your present software/systems by implementing the recommended workarounds outlined here.

ANOMALY STATUS

Reference Number	Description	Status
er001	MSC_CTRL register programmed with incorrect default value	Fixed

MSC_CTRL DEFAULT VALUE INCORRECT [er001]

Background	The ADIS16365 offers a data ready option with either DIO1 or DIO2, depending on the setting in MSC_CTRL Bits[2:0].
Issue	The factory default setting for MSC_CTRL is 0x0006, which sets DIO1 as a positive pulse, data ready signal. For some parts with a date code earlier than 0918, the factory default value was 0x0000, which disables the data ready function on DIO1. This has been resolved, and all new parts have a factory default setting of 0x0006 for MSC_CTRL. In addition, after this error was discovered, all existing inventory was corrected.
Workaround	When the power supply reaches 4.75 V, wait 500 ms to ensure that the part has started up, and then set MSC_CTRL Bits[7:0] = 0x06 by writing DIN = 0xB406. Next, execute a manual flash update by writing DIN = 0xBE08 (GLOB_CMD Bit3 = 1). Wait 100 ms, and then the device will operate with DIO1 as a positive pulse, data ready signal, and the setting will be nonvolatile.
Related Issues	None.

Rev. 0

Information furnished by Analog Devices is believed to be accurate and reliable. However, no responsibility is assumed by Analog Devices for its use, nor for any infringements of patents or other rights of third parties that may result from its use. Specifications subject to change without notice. No license is granted by implication or otherwise under any patent or patent rights of Analog Devices. Trademarks and registered trademarks are the property of their respective owners.

One Technology Way, P.O. Box 9106, Norwood, MA 02062-9106, U.S.A.
Tel: 781.329.4700 www.analog.com
Fax: 781.461.3113 ©2009 Analog Devices, Inc. All rights reserved.

NOTES

Данный компонент на территории Российской Федерации

Вы можете приобрести в компании MosChip.

Для оперативного оформления запроса Вам необходимо перейти по данной ссылке:

<http://moschip.ru/get-element>

Вы можете разместить у нас заказ для любого Вашего проекта, будь то серийное производство или разработка единичного прибора.

В нашем ассортименте представлены ведущие мировые производители активных и пассивных электронных компонентов.

Нашей специализацией является поставка электронной компонентной базы двойного назначения, продукции таких производителей как XILINX, Intel (ex.ALTERA), Vicor, Microchip, Texas Instruments, Analog Devices, Mini-Circuits, Amphenol, Glenair.

Сотрудничество с глобальными дистрибьюторами электронных компонентов, предоставляет возможность заказывать и получать с международных складов практически любой перечень компонентов в оптимальные для Вас сроки.

На всех этапах разработки и производства наши партнеры могут получить квалифицированную поддержку опытных инженеров.

Система менеджмента качества компании отвечает требованиям в соответствии с ГОСТ Р ИСО 9001, ГОСТ РВ 0015-002 и ЭС РД 009

Офис по работе с юридическими лицами:

105318, г.Москва, ул.Щербаковская д.3, офис 1107, 1118, ДЦ «Щербаковский»

Телефон: +7 495 668-12-70 (многоканальный)

Факс: +7 495 668-12-70 (доб.304)

E-mail: info@moschip.ru

Skype отдела продаж:

moschip.ru

moschip.ru_4

moschip.ru_6

moschip.ru_9