## **Multifunction Counter (DIN 72 × 72)**

## H7BX

CSM\_H7BX\_DS\_E\_4\_5

# DIN 72 $\times$ 72 mm Multifunction Counter with a Bright, Easy-to-view, Negative Transmissive LCD.

- Highly visible display with backlit transmissive LCD.
- Selectable display color (red/green) enables checking output status at a distance.
- Easy operation with a key for each digit.
- Perform all basic settings with a DIP switch.
- Provides a total and preset counter, batch counter, dual counter, and tachometer (See note.).
- Wide range of inputs accepted for NPN/PNP inputs (multi-inputs) and 2wire DC sensors.
- Complies with UL, CSA, and CE marking.
- Degree of protection: IP54 equivalent (front section only).

Note: The functions that can be selected depend on the model.



For the most recent information on models that have been certified for safety standards, refer to your OMRON website.

 $\wedge$ 

Refer to Safety Precautions on page 25.

## **Ordering Information**

#### **List of Models**

External power supply	Output type	Supply voltage	1-stage	2-stage
12 VDC	Contact and	100 to 240 VAC	H7BX-A	H7BX-AW
	NPN transistor output	24 VAC/12 to 24 VDC	H7BX-AD1	H7BX-AWD1

## **Accessories (Order Separately)**

Name	Model
Soft Cover	Y92A-72F1
Hard Cover	Y92A-72
Terminal Cover *	Y92A-72T

<sup>\*</sup> Supplied with the H7BX.

## **Specifications**

## **Ratings**

Item	Model	H7BX-A/AD1	H7BX-AW/AWD1		
Туре		Preset counter	Preset counter/tachometer		
Supported configurations		1-stage preset counter, total and preset counter *1 (selectable)	1-stage preset counter, 2-stage preset counter, total and preset counter (*1), batch counter, dual counter, tachomete (selectable)		
Power supply voltage *2		H7BX-A/AW: 100 to 240 VAC (50/60 Hz) H7BX-AD1/AWD1: 24 VAC (50/60 Hz)/12 to 24 VDC (ripple 20% max.)			
Ratings	Operating voltage range	85% to 110% of rated supply voltage (90% to 110% at 12 VD	C)		
	Power consumption	H7BX-A/AW: 9.6 VA max. (100 to 240 VAC) H7BX-AD1/AWD1: 8 VA max. (24 VAC), 5.3 W max. (12 to 2	4 VDC)		
Mounting	method	Flush mounting			
External c	connections	Screw terminals			
Degree of	protection	IP54 (front section only)			
Input sign	nals	CP1, CP2, reset 1, reset 2, key protection			
	Max. counting speed	30 Hz or 5 kHz (selectable, ON/OFF ratio 1:1), setting for both CP1 and CP2			
	Input modes	Increment, decrement, command (UP/DOWN A), individual (UP/DOWN B), quadrature (UP/DOWN C)			
Counter	Output modes	N, F, C, R, K-1, P, Q, A, K-2, D, L N, F, C, R, K-1, P, Q, A, K-2, D, L, H			
	One-shot output time	0.01 to 99.99 s			
	Reset input	External reset (minimum reset input signal width: 1 ms or 20 ms selectable), manual reset, and automatic reset (internaccording to C, R, P, and Q mode operation)			
	Pulse measurement method		Periodic measurement (Sampling period: 200 ms)		
	Max. counting speed		30 Hz or 10 kHz (selectable)		
	Measuring ranges		30 Hz: 0.01 to 30.00 Hz 10 kHz: 0.01 Hz to 10 kHz		
Tachometer	Measuring accuracy		±0.1% FS ±1 digit max. (at 23 ±5°C)		
	Output modes		Upper and lower limits, area, upper limit, lower limit		
	Auto-zero time		0.1 to 99.9 s		
	Startup time		0.0 to 99.9 s		
	Average processing		OFF/2/4/8 times		
Prescaling function		Yes (0.001 to 99.999)			
	oint adjustment	Yes (rightmost 3 digits)			
·	•	290 ms max. (Control output is turned OFF and no input is accepted during sensor waiting time.)			
Sensor waiting time  Key protection input		Response speed: Approx. 1 s No-voltage NPN input (fixed) Short-circuit (ON) impedance: 1 kΩ max. (Leakage current at 0 Ω: Approx. 12 mA) Short-circuit (ON) residual voltage: 3 V max. Open (OFF) impedance: 100 kΩ min.			
Input method (except key protection input)		No-voltage NPN input or voltage PNP input (selectable) No-voltage input Short-circuit (ON) impedance: $1 \text{ k}\Omega$ max. (Leakage current at $0 \Omega$ : Approx. 12 mA) Short-circuit (ON) residual voltage: $3 \text{ V}$ max. Open (OFF) impedance: $100 \text{ k}\Omega$ min. Voltage input High level: $4.5 \text{ to } 30 \text{ VDC}$ Low level: $0 \text{ to } 2 \text{ VDC}$ Input resistance: Approx. $4.7 \text{ k}\Omega$			
External p	ower supply	12 VDC (±10%), 100 mA (For details, refer to External Power Supply on page 26.)			
Control output		Contact output: 3 A at 250 VDC/30 VDC, resistive load (cos\phi = 1) Minimum applied load: 10 mA at 5 VDC (Failure level: P, reference value) Transistor output: 100 mA max. at 30 VDC max. Residual voltage: 1.5 VDC max. (approx. 1 V) Leakage current: 0.1 mA max.			
Display *3		Backlit 7-segment negative transmissive LCD Character Heights PV: 13.5 mm (red/green) SV: 9 mm (green)			
Digits		6 digits -99,999 to 999,999 (5 digits negative and 6 digits positive)	6 digits Counter: -99,999 to 999,999 (5 digits negative and 6 digits positive) Tachometer: 0 to 999,999 (6 digits)		
Memory backup		EEPROM (Overwrites: 100,000 min.), Data storage: 10 years min.			
Ambient operating temperature		−10 to 55°C (with no icing)			
Ambient storage temperature		−25 to 65°C (with no icing)			
Ambient operating humidity		25 to 85°C (with no condensation)			
Case color		Black (N1.5)			
Accessori	ies	Two flush-mounting adapters, terminal cover	Two flush-mounting adapters, terminal cover, DIP switch setting stickers		

<sup>\*1.</sup> The total and preset counter functions as a 1-stage preset counter and total counter.
\*2. Do not use an inverter output for the power supply.
\*3. Displayed only when the power is ON. Not displayed when the power is OFF.

### **Characteristics**

Insulation resistance	100 M $\Omega$ min. (at 500 VDC) between current-carrying terminal and exposed non-current-carrying metal parts, and between non-continuous contacts	
Between current-carrying metal parts and non-current-carrying metal 2,000 VAC, 50/60 Hz for 1 min  Between power supply and input circuit: 2,000 VAC, 50/60 Hz for 1 m (for models other than the H7BX-A□D1)  1,000 VAC, 50/60 Hz for 1 min (H7BX-A□D1)  Between control output, power supply, and input circuit: 2,000 VAC, 50/60 Hz for 1 min  Between non-continuous contacts: 1,000 VAC, 50/60 Hz for 1 min		
Impulse withstand voltage	Between power terminals: 3.0 kV (1.0 kV for 24 VAC/12 to 24 VDC models) Between current-carrying terminal and exposed non-current-carrying metal parts: 4.5 kV (1.5 kV for 24 VAC/12 to 24 VDC models)	
Noise immunity	Between power terminals: ±1.5 kV Between input terminals: ±600 V Square-wave noise by noise simulator (Pulse width: 100 ns/1 μs, 1-ns rise)	
Static immunity	Malfunction: 8 kV Destruction: 15 kV	
Vibration resistance	Destruction: 10 to 55 Hz, 0.75-mm single amplitude, 2 hours each in three directions Malfunction: 10 to 55 Hz, 0.50-mm single amplitude, 10 minutes each in three directions	
Shock resistance	Destruction: 294 m/s² 3 times each in 6 directions  Malfunction: 98 m/s² 3 times each in 6 directions	
Life expectancy	Mechanical: 10,000,000 operations min. Electrical: 100,000 operations min. (3 A at 250 VAC/30 VDC, resistive load) *	
Weight	Approx. 250 g	

<sup>\*</sup> Check the electrical life expectancy curve.


## **Applicable Standards**

Approved safety standards	cURus: UL 508, CSA C22.2 No. 14 EN 61010-1 (IEC 61010-1): Pollution degree 2/overvoltage category II; EN 61326; VDE 0106 Part 100		
ЕМС	(EMI) Emission Enclosure: Emission AC mains: (EMS) Immunity ESD: Immunity RF-interference: Immunity Conducted Disturbance: Immunity Burst: Immunity Surge:	EN 61000-4-3: EN 61000-4-6: EN 61000-4-4: EN 61000-4-5:	p 1 class A  4 kV contact discharge; 8 kV air discharge 10 V/m (Amplitude-modulated, 80 MHz to 1 GHz); 10 V/m (Pulse-modulated, 900 MHz ±5 MHz) 3 V (0.15 to 80 MHz) 2 kV power-line; 1 kV I/O signal-line 1 kV line to lines (power and output lines (relay outputs)); 2 kV line to ground (power and output lines (relay outputs))


<sup>\*</sup> Industrial electromagnetic environment (EN/IEC 61326-1 Table 2)

#### **Electrical Life Expectancy** (Reference Values)

#### **Resistive Load**

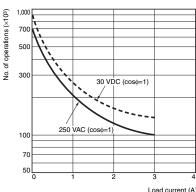

#### **Inductive Load**

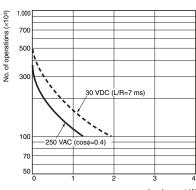

A current of 0.15 A max. can be switched at 125 VDC ( $\cos\phi = 1$ ) and current of 0.1 A max. can be switched with L/R = 7 m/s. In both cases, a life of 100,000 operations can be expected.

## **I/O Functions**

### Using as a Counter \*1

	CP1, CP2	<ul> <li>(1) All Modes Except for Dual Counter Mode</li> <li>Reads count signals.</li> <li>Increment, decrement, up/down (command, individual, or quadrature) inputs can be used.</li> <li>(2) Dual Counter Mode</li> <li>Reads CP1 count signals on CP1 input and CP2 count signals on CP2 input.</li> <li>Increment signals can be used.</li> </ul>	
Inputs	Reset or Reset 1	(1) All Modes Except for Dual Counter Mode  Resets present value and outputs (OUT2 when using the batch counter). *2  Counting cannot be performed while resetting or when reset 1 input is ON.  The reset indicator is lit while the reset input is ON.  Dual Counter Mode  Resets the CP1 present value to 0.  Counting the CP1 input cannot be performed while the reset 1 input is ON.  The reset indicator is lit while the reset 1 input is ON.	
	Total Reset or Reset 2	The reset operation depends on the selected function. *3	
Outputs	OUT1, 2	When the corresponding set value is reached, signals are output according to the designated output mode.	

- \*1. Refer to pages 14 to 17 for information on the operation of input and output functions.
- \*2. In increment mode or increment/decrement mode, the present value returns to 0; in decrement mode, the present value returns to the set value with 1-stage models, and returns to set value 2 with 2-stage models.
- \*3. The reset indicator will not be lit when the total reset or reset 2 input is ON.

Function	Reset operation	
1-stage/2-stage preset counter	Does not operate (Not used).	
Total and preset counter	Resets the total count value. Holds the total count value at 0 while the total reset input is ON.	
Batch counter	Resets the batch count value and batch output (OUT1).     Holds the batch count value at 0 while the reset 2 input is ON.	
Dual counter	Resets the CP2 present value.     Counting for CP2 input is disabled while the reset 2 input is ON.	

### **Using as a Tachometer**

	CP1, CP2	Reads counting signals. (CP2 input is not available.)	
Inputs	Reset 1, Reset 2	Holds the measurement value and outputs. (Reset 2 input is not available.)     The reset indicator is lit during hold.	
Outputs OUT1, 2		Outputs signals according to the specified output mode when a set value is reached.	

## Using as a Counter or Tachometer

Key protection input	Prohibits using the keys on the front panel.  Set the key protection level in function selection mode.  Key protection is enable by short-circuited key protection terminals.
----------------------	---


Note: For details, refer to page 24.

### **Connections**


#### **Terminal Arrangement**

Confirm that the power supply meets specifications before using the H7BX.


#### H7BX-A

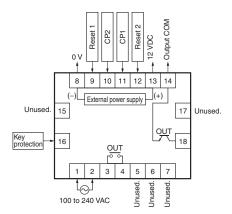


#### H7BX-AW

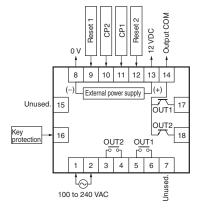

#### H7BX-AD1

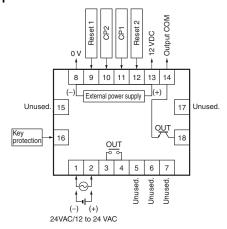


H7BX-AWD1

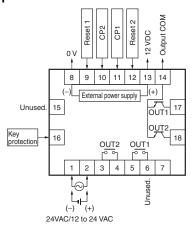


Note: Do not use the unused terminals for relay connections.

#### **Block Diagram**

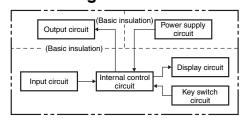

## Input Circuits CP1, CP2, Reset/Reset 1, and Total Reset/Reset 2 Input

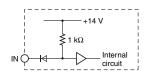


**Note:** The circuit shown above is for no-voltage input (NPN input).

#### **Input Connections**

A no-voltage input (short-circuit or open) or voltage input can be selected for each input. (The key protection input is always a no-voltage input (NPN input)).

#### No-voltage Inputs (NPN Inputs)

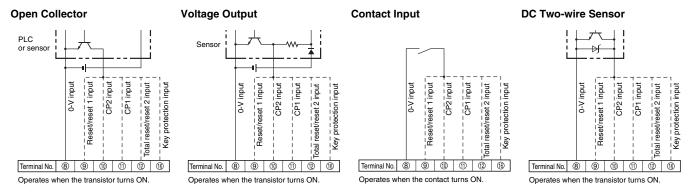

Note: When using the H7BX as a tachometer, do not use the CP2 input or total reset/reset 2 input.

#### **No-voltage Input Signal Levels**

No-contact input	Short-circuit level Transistor ON • Residual voltage: 3 V max. • Impedance when ON: 1 kΩ max. (The leakage current is approx. 12 mA when the impedance is 0 Ω.)
	Open level Transistor OFF • Impedance when OFF: 100 kΩ min.
Contact input	Use contact which can adequately switch 5 mA at 10 V.


**Applicable Two-wire Sensors** 

- Leakage current: 1.5 mA max.
- Switching capacity: 5 mA min.
- Residual voltage: 3 VDC max.
- Operating voltage: 10 VDC


Note: Use a DC power supply of 30 V max.

#### **Voltage Inputs (PNP Inputs)**


#### **No-contact Input (NPN Transistor)**

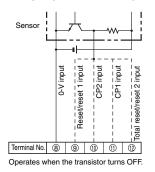

#### **No-contact Input (PNP Transistor)**

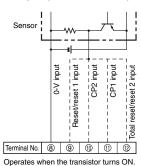

## **Contact Input**

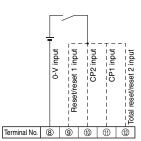

Operates when the contact turns ON.

Note: When using the H7BX as a tachometer, do not use the CP2 input or total reset/reset 2 input.

#### **Voltage Input Signal Levels**

High level (Input ON): 4.5 to 30 VDC	
Low level (Input OFF): 0 to 2 VDC	

Note: 1. Use a DC power supply of 30 V max.

2. Input resistance: Approx. 4.7 k $\Omega$ 

#### **Nomenclature**

#### Indicators

- Reset Indicator (Orange)
   Lit when the reset input (1) or reset key is ON.
- 2 Key Protection Indicator (Orange)
- ③ Control Output Indicator (Orange) OUT: One stage OUT1, OUT2: Two stages
- (4) Present Value (Main Display) Character height: 13.5 mm (Red/green selectable)
- (5) Set Value (Sub-display) Character height: 9 mm (Green)
- (6) Total Count Indicator (Green) Lit when the total count value is displayed.
- (7) Batch Indicator (Green) Lit when the batch count value is displayed.
- (Breen) 8 Set Value 1 and 2 Stage Indicators (Green)





#### Operation Keys

- Mode Key Used to switch mode and setting items.
- (10) Reset Key
- 11) Up Keys: 1 to 6

#### Switches

12) DIP Switch




(Unit: mm)


## **Dimensions**

## Counter

#### Counter H7BX-A□□



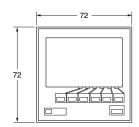

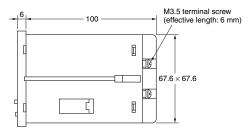


Note: M3.5 terminal screws (effective length: 6 mm).


#### **Dimensions with Flush Mounting Adapter**

#### H7BX-A□□

#### (The flush mounting adapter is supplied with the H7BX.)




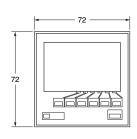

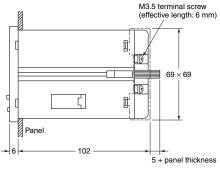

#### Panel Cutouts

Panel cutouts are as shown below (according to DIN 43700).

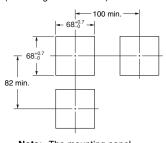

Note: The mounting panel thickness must be 1 to 5 mm.

## **Accessories (Order Separately)**

#### Soft Cover Y92A-72F1



Note: Depending on the operating environment, the condition of resin parts may deteriorate, and may shrink or harden. Therefore, it is recommended that resin parts are replaced regularly.

#### Product Protection for Use in Environments Subject to Water or Oil

The panel surface has a protective structure so that the internal circuits will not be adversely affected if drops of water penetrate the gaps between the keys. If, however, there is a possibility of water or oil being present on the operator's hands, mount the optional Soft Cover. The Soft Cover ensures protection equivalent to IP54. Do not, however, use

the H7BX in locations where it would come


into direct contact with oil.

#### Hard Cover Y92A-72



## Terminal Cover \* Y92A-72T

(VDE0106/T100)

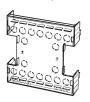

\* Supplied with the H7BX.

## **Operating Procedures**

## **Setting Procedure Guide Settings for Counter Operation**

(1-stage/2-stage Counter, Total and Preset Counter, Batch Counter, Dual Counter)

Using Basic Settings Only Basic Settings

- Counting speed (30 Hz, 5 kHz)
- Input mode (UP, DOWN)
- Output mode (N, F, C, K-1)
- One-shot output time (0.5 s, 0.05 s)
- Reset input signal width (20 ms, 1 ms)
- NPN/PNP input mode (NPN, PNP)

The settings can be made easily with the DIP switch.

➡ For details on the setting methods, refer to page 9.



 Using Input Modes Not Given Above (Up/Down A, Up/Down B, Up/Down C), Output Modes (R/P/Q/A/K-2/D/L/H), or (OUT2) Output Time

Set all functions with the operation keys. 

→ For details on the setting methods, refer to page 10.

 Performing Advanced Settings: Dual Count Calculating Mode, Output 1 Time, Decimal Point Position, Prescale Value, Display Color, or Key Protect Level

Settings other than the basic functions above can be performed with the operation keys.

→ For details on the setting methods, refer to page 10.

\_\_\_\_\_

Note: The default setting is for a 1-stage preset counter. (For models with a 2-stage setting, the default is a 2-stage preset counter.)

### Setting for Tachometer Operation (H7BX-AW□ only)

Using Basic Settings Only

**Basic Settings** 

- Counting speed (30 Hz, 10 kHz)
- Output mode (HI-LO, AREA, HI-HI, LO-LO)
- Average processing (OFF, 2, 4, 8 times)
- NPN/PNP input mode (NPN, PNP)

The settings can be made easily with the DIP switch.

→ For details on the setting methods, refer to page 19.



 Performing Advanced Settings: Decimal Point Position, Prescale Value, Auto-zero Time, Startup Time, Display Color, or Key Protect Level

Settings other than the basic functions above can be performed with the operation keys.


→ For details on the setting methods, refer to page 20.

Note: The default setting is for a 2-stage preset counter.

#### **Operating Procedures (Counter Function)**

#### **Settings for Basic Operations**

### Settings for basic functions can be performed with just the DIP switch.

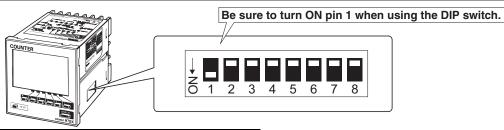

	Item	OFF	ON	
1	DIP switch settings enable/disable	Disabled	Enabled	
2	Counting speed	30 Hz	5 kHz	
3	Input mode	UP (increment)	DOWN (decrement)	
4 Output made		Defer to the table on the wight		
5	Output mode	Refer to the table on the right.		
6	One-shot output time (See note.)	0.5 s 0.05 s		
7	Reset input signal width	20 ms 1 ms		
8	NPN/PNP input mode	NPN (no-voltage)	PNP (voltage)	

Pin 4	Pin 5	Output mode
OFF	OFF	N
ON	OFF	F
OFF	ON	С
ON	ON	K-1

Note: All the pins are factory-set to OFF.

The ON/OFF status of the DIP switch pins can be confirmed using the front display. For details, refer to page 23.



Caution

- Always turn OFF the power supply before changing the DIP switch settings.
- Always turn ON pin 1 when performing settings with the DIP switch. Performing settings with the DIP switch is disabled when pin 1 is OFF.
- · DIP switch setting changes will be updated when the power is turned ON. Perform the settings before performing installation and supplying power.
- Properly set the DIP switch to match the item being counted (or measured) and use the DIP switch monitor for confirmation.
- Use the keys on the front panel to perform all settings for input modes, output modes, and output times that cannot be set with the DIP switch. For details on the setting methods, refer to page 10. When performing these settings, always turn OFF pin 1(DIP switch setting) (disabled).




#### Using the H7BX as a Total and Preset Counter, Batch Counter, or Dual Counter

The default setting is for a 1-stage preset counter. (For models with a 2-stage setting, the default is for a 2-stage preset counter.) To make changes, use the procedure shown on the right. For details, refer to page 23.

Hold down the MODE Key and press the Up 1 Key for at least 1 s. The mode will not change if the Up 1 Key is

pressed first.

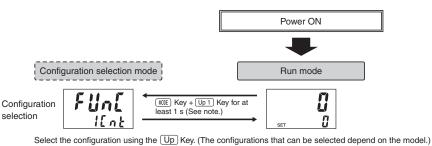

→ |[nt ←→ 2[nt ←→ t[nt ←→ b[nt ←→ d[nt ←→ tR[ă+ (1-stage preset counter) (2-stage preset counter) (Total and preset counter) (Batch counter) (Dual counter) (Tachometer)


Note: This includes using a model with a 2-stage setting as a 1-stage preset counter.



After setting the DIP switch for basic operations, advanced functions (\*) can be added using the operation keys. For details, refer to page 10.

Advanced functions consist of dual count calculating mode, output 1 time, decimal point position, prescale value, display color, and key protect level.

When using the H7BX as a Total and Preset Counter, Batch Counter, or Dual Counter, switch the configuration using the procedure on page 23. **Setting Advanced Functions** 

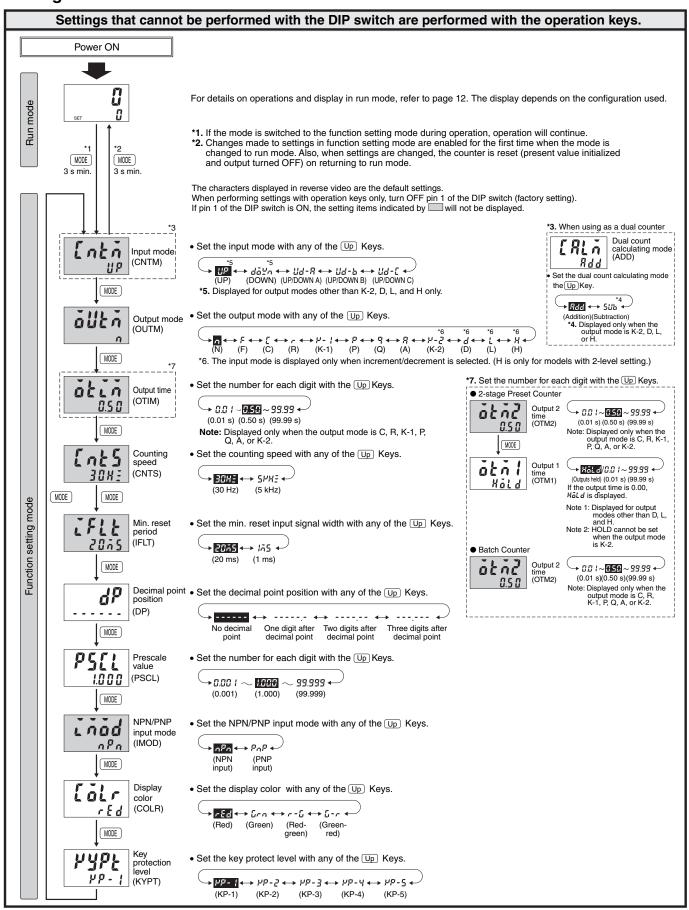

### **Explanation of Functions**

Settings marked with a star can be performed with the DIP switch.

#### • Input Mode (โกะกั) ★

Set increment mode (UP), decrement mode (DOWN), or one of the increment/decrement modes (UP/DOWN A, UP/DOWN B, or UP/DOWN C) as the input mode. Input modes other than UP or DOWN modes cannot be set using the DIP switch. Use the operation keys if other modes are required. (For details on the operation of the input modes, refer to *Input Modes and Present Value* on page 13.)

#### • Dual Count Calculating Mode ([RL n)

When the H7BX using as a dual counter, select either ADD (addition) or SUB (subtraction) as the calculation method for the dual count value.

ADD: Dual count value = CP1 PV + CP2 PV SUB: Dual count value = CP1 PV - CP2 PV

#### • Output Mode (อัปะกั) ★

Set the way that control output for the present value is output. The possible settings are N, F, C, R, K-1, P, Q, A, K-2, D, L, and H. Output modes other than N, F, C, or K-1 cannot be set using the DIP switch. Use the operation keys if other modes are required. The output modes that can be set vary with the model. (For details on the operation of the output modes, refer to *Input/Output Mode Settings* on page 14.)

#### • One-shot Output Time (סֹבנֿה) ★

Set the one-shot output time (0.01 to 99.99 s) for the control output. A one-shot output can be used only when C, R, K-1, P, Q, A, or K-2 is selected as the output mode. Output times other than 0.5 s or 0.05 s cannot be set with the DIP switch. Use the operation keys if other settings are required.

#### • One-shot Output 2 Time (otā) ★

When the H7BX using as a 2-stage counter or batch counter, set the one-shot output time (0.01 to 99.99 s) for control output (OUT2). A one-shot output can be used only when C, R, K-1, P, Q, A, or K-2 is selected as the output mode. Output times other than 0.5 s or 0.05 s cannot be set with the DIP switch. Use the operation keys if other settings are required.

#### • One-shot Output 1 Time (oto !)

When the H7BX using as a 2-stage counter, set the one-shot output time (0.01 to 99.99 s) for control output (OUT1). A one-shot output can be used only when D, L, or H is selected as the output mode. If the output time is set to 0.00, HāL d is displayed, and outputs are held.

#### • Counting Speed (£n£5) ★

Set the maximum counting speed (30 Hz/5 kHz) for CP1 and CP2 inputs together. If contacts are used for input signals, set the counting speed to 30 Hz. Processing to eliminate chattering is performed for this setting.

#### • Reset Input Signal Width (LFLL) ★

Set the reset input signal width (20 ms/1 ms) for reset/reset 1 and total reset/reset 2 inputs together. If contacts are used for input signals, set the counting speed to 20 ms. Processing to eliminate chattering is performed for this setting.

#### • Decimal Point Position (dP)

Decide the decimal point position for the present value, CP1/CP2 present values, set values (SV1, SV2), total count value, dual count value and dual count set value.


#### • Prescale Value (PSEL)

Pulses input to the counter are converted according to the specified prescale value.

Setting range: 0.001 to 99.999

Example: To display the feed distance for systems that output 25 pulses for a feed length of 0.5 m in the form  $\square\square.\square\square$  m:

- 1. Set the decimal point position to 2 decimal places.
- 2. Set the prescale value to 0.02 (0.5  $\div$  25).

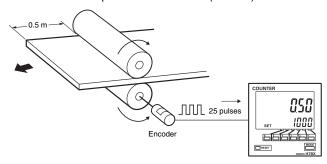

Note: Incorrectly setting the prescale value will result in counting errors. Check that the setting has been performed correctly before using the H7BX.

#### • NPN/PNP Input Mode (Lňåd)

Select either NPN input (no-voltage input) or PNP input (voltage input) as the input format. For 2-wire sensors, set the format to NPN input. The same format setting applies to all external inputs. For information on input connections, refer to page 6.

#### • Display Color ([alr)

Set the color used for the present value.

	Output OFF *	Output ON *		
rEd	Red (fixed)			
Gra	Green (fixed)			
r-5	Red Green			
<b>ũ-</b> r	Green Red			


<sup>\*</sup>When the H7BX using as a 2-stage counter, this is the status of output 2.

#### • Key Protect Level (PYPL)

Set the key protect level.


For details, refer to Key Protect Level on page 24.

### **Operation in Run Mode**

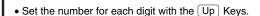



• 1-stage Counter

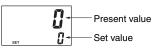

Present Value


Shows the present count value.

• Set Value (Set Value 1, Set Value 2)


Set the set value.

When the present value reaches the set value, signals are output according to the specified output mode.

• 2-stage Counter

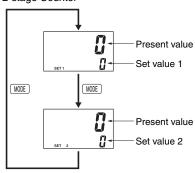

Total and Preset Counter

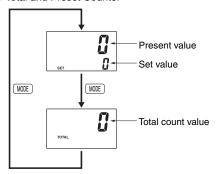


• Present Value/Set Value

Same as 1-stage counter.

Total Count Value

Shows the present total count value.

Batch Counter

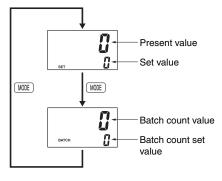

• Present Value/Set Value

Same as 1-stage counter.


Batch Count Value

Shows the number of times the count has been completed for the present value.

Batch count value • Batch Count Set Value

Set the batch count set value. When the batch count value reaches the batch count set value, batch output (OUT1) turns ON.

Dual Counter

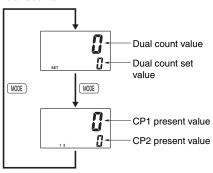

• Dual Count Value

Shows the sum of the CP1 present value and CP2 present value when the dual count calculating mode is ADD and shows the value obtained by subtracting the CP2 present value from the CP1 present value when the dual count calculating mode is SUB.


• Dual Count Set Value


Set the dual count set value. When the dual count value reaches the dual count set value, signals are output according to the specified output mode.


• CP1/CP2 Present Value

Show the present count values for CP1 and CP2 present values respectively.

#### Input Modes and Present Value (See note 1.)

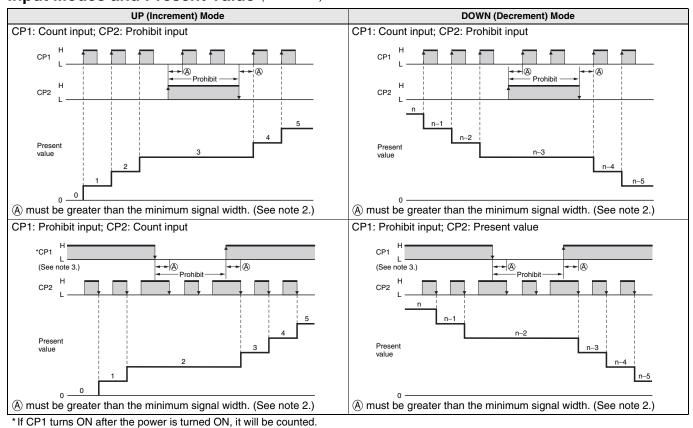

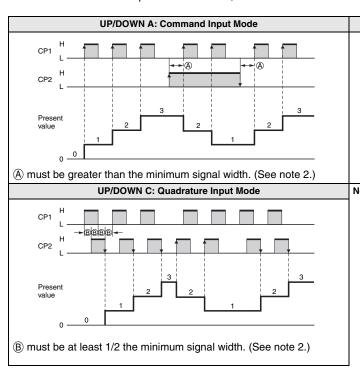

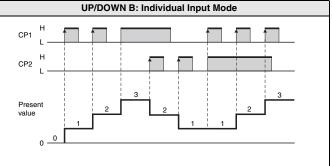


- Note: 1. If the configuration is set to dual counter, CP1 and CP2 inputs will operate in the same way as the count input (CP1) of UP (increment) mode.
  - mode. 2. A must be greater than the minimum signal width and B must be at least 1/2 the minimum signal width. If they are less, a count error of  $\pm 1$  may occur.
    - Minimum signal width: 16.7 ms (when maximum counting speed = 30 Hz)
  - 100 μs (when maximum counting speed = 5 kHz) 3. The meaning of the H and L symbols in the tables is explained below.
  - | Input method | No-voltage input | Voltage input | Symbol | (NPN input) | (PNP input)


## **Input/Output Mode Settings**

Operation for 1-stage models is the same as that for OUT2. When using a 2-stage model as a 1-stage counter, total and preset counter, or dual counter, OUT1 and OUT2 turn ON and OFF simultaneously.



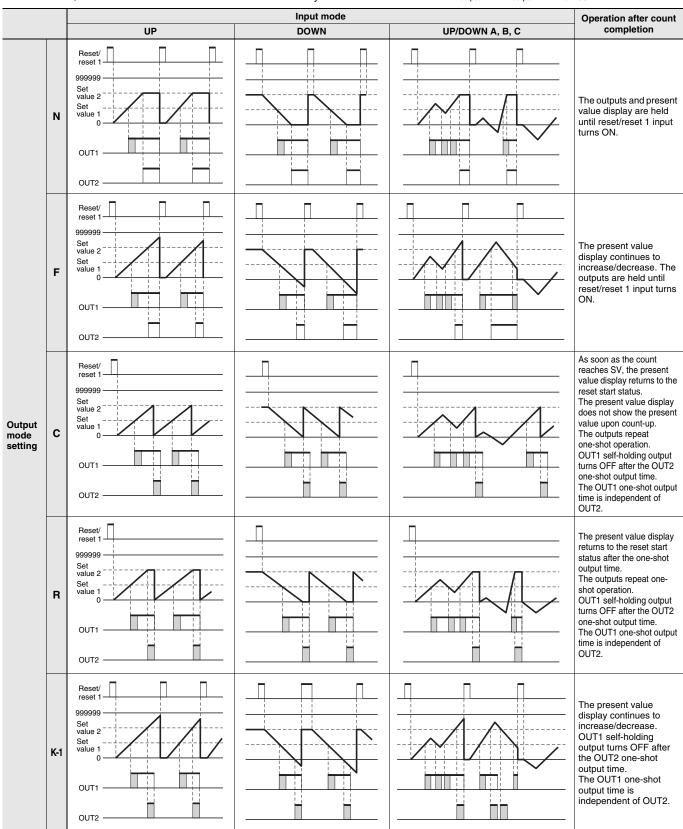



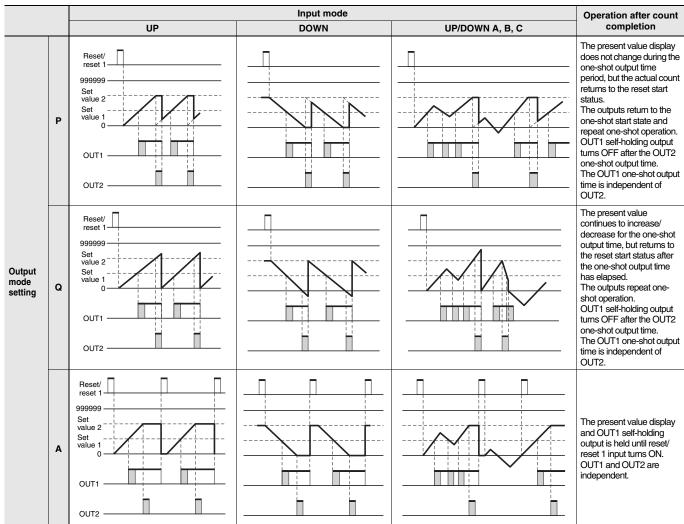


Note: 1. When the present value reaches 999999, it returns to 0.

- 2. Counting cannot be performed while the reset/reset 1 input is ON.
- 3. If reset/reset 1 input turns ON while the one-shot output is ON, one-shot output turns OFF.
- 4. If there is power failure while an output is ON, the output will turn ON again when the power supply has recovered. For a one-shot output, the output will turn ON again for the duration of the output time setting once the power supply has recovered.
- 5. Do not use the counter function in applications where the count may be completed (again) while the one-shot output is ON.
- 6. The set values are between 0 and 999999.

Self-holding Instantaoutput neous (equals)

(The one-shot output time can be set in the range 0.01 to 99.99s.)

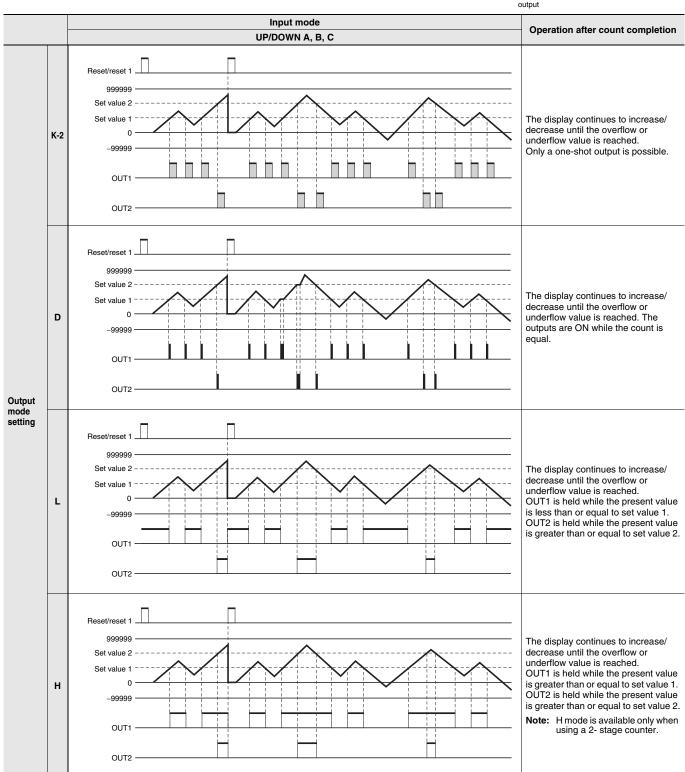


Note: 1. Counting cannot be performed while the reset/reset 1 input is ON.

- 2. If reset/reset 1 input turns ON while the one-shot output is ON, the one-shot output turns OFF.
- 3. If there is power failure while the output is ON, the output will turn ON again when the power supply has recovered. For a one-shot output, the output will turn ON again for the duration of the output time setting once the power supply has recovered.
- 4. Do not use the counter function in applications where the count may be completed (again) while the one-shot output is ON.
- 5. The set values are between –99999 and 999999.

#### **Total and Preset Counter Operation**

The H7BX has a total counter separate from the 1-stage preset counter for counting the total accumulated value.

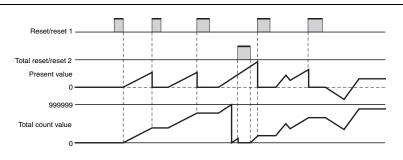


- The total counter continues to count the total accumulated value when the present value is reset using reset/reset 1 input (Reset Key).
- The total count value is reset when the total reset/reset 2 input is turned ON.
   If the Reset Key is pressed while the total count value is displayed, the total count value is reset. The present value is also reset at this time.
- The counting range of the total counter is

   99,999 to 999,999. The total count value
   returns to 0 when it reaches the full scale limit.

#### **Batch Counter Operation**

The H7BX has a batch counter separate from the 1-stage preset counter for counting the number of times the count has been completed.

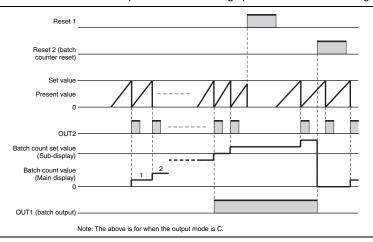


- The batch counter continues after count completion.
- Batch output is held until batch counter reset input turns ON.
- When the batch counter reset input is turned ON, the batch count value is reset, and batch output turns OFF.
- If the Reset Key is pressed while the batch count value is displayed, the batch count value is reset and batch output turns OFF.
   The present value is also reset at this time.
- Note: 1. The batch count value is held at 0 while the batch counter reset input is on.
  - 2. If the batch count set value is 0, batch count will be performed but there will be no batch output.
  - 3. The batch count value returns to 0 when it reaches 999,999
  - 4. Once batch input has been turned ON, it will return to the ON state after power interruptions.
  - 5. If the batch count set value is changed from a value that is greater than the batch count value to one that is less, batch output will turn ON.
  - 6. After batch output turns ON, the ON state will be held even if the batch count set value is changed to a value greater than the batch count value.


#### **Dual Counter Operation**

Using the dual counter allows the count from 2 inputs to be added or subtracted and the result displayed. It is possible to specify a set value for which output turns ON when the set value matches the added or subtracted result.

## (1) Dual Count Calculating Mode = ADD Dual count value = CP1 PV + CP2 PV

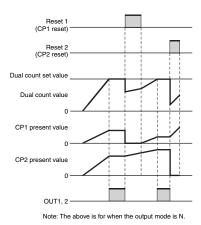

## (2) Dual Count Calculating Mode = SUB Dual count value = CP1 PV - CP2 PV

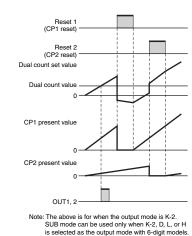

- The operation after count completion for the dual counter value is determined by the output mode.
- The CP1 present value is reset when reset 1 input is turned ON and the CP2 present value is reset when reset 2 input is turned ON.
- If the Reset Key is pressed while the dual count value, CP1 present value, or CP2 present value is displayed, all of the present values are reset and the outputs turn OFF. At this time, counting is not possible for CP1 or CP2 inputs.
- Note: 1. Counting is not possible for CP1 while the reset 1 input is ON. CP2 is not affected. The dual count value will be calculated based on a CP1 present value of 0.
  - Counting is not possible for CP2 while the reset 2 input is ON. CP1 is not affected. The dual count value will be calculated based on a CP2 present value of 0.
  - 3. The counting range for the dual count value is –99,999 to 999,999.
    - The counting ranges for the CP1 present value and CP2 present value are 0 to 999,999.
    - If a present value exceeds 999,999, FFFFFF will be displayed to indicate an overflow, and all counting will stop.


## **Reset Function List**

Function	1-stage/2-stage counter	Total and pro	eset counter	nter Batch counter		Dual counter	
Display in run mode	Present value/ set value (1, 2)	Present value/ set value	Total count value	Present value/ set value	Batch count value/batch count set value	Dual count value/dual count set value	CP1 present value/CP2 present value
Reset/reset 1	Present value and output reset.	Present value and output reset.		Present value and output reset.		Only the CP1 present value is reset.	
Total reset/ reset 2	No effect.	Only the total count value is reset.		Batch count va output	alue and batch reset.	Only the CP2 pres	sent value is reset.
Reset Key	Present value and output reset.	Present value and output reset.	Present value, total count value, and output reset.	Present value and output reset.	Present value, batch count value, output and batch output reset.	CP1 present value, CP2 present value, dual count value, and output reset.	

### Operating Procedures (Tachometer Function) (H7BX-AW□ only)

#### Switching from Counter to Tachometer

The H7BX is factory-set to the 2-stage counter configuration. To switch to the tachometer Power ON configuration, use the procedure shown on the right. For details. refer to page 23. Configuration selection mode Run mode \* Hold down the MODE Key and then press Configuration WODE Key + Up 1 Key for at selection the Up 1 Key for at least 1 s. The mode will not change if the Up 1 Switch from **Elak** to **ERLo** (tachometer) with the Up Key. Key is pressed first.

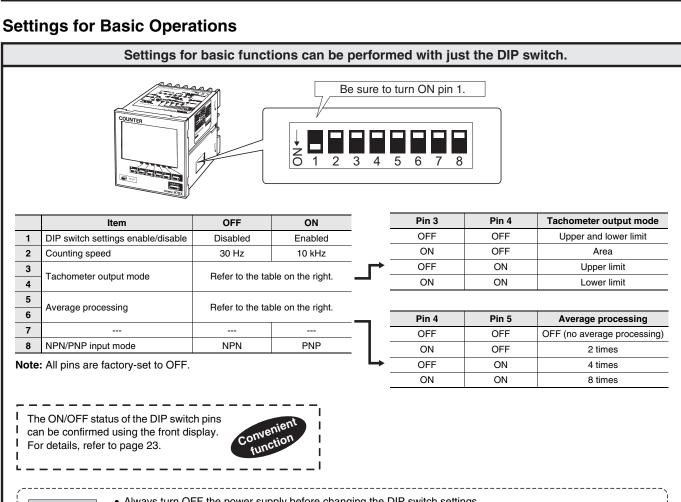

Caution

- Always turn OFF the power supply before changing the DIP switch settings.
- · Always turn ON pin 1 when performing settings with the DIP switch. Performing settings with the DIP switch is disabled when pin 1 is OFF.
- DIP switch setting changes will be updated when the power is turned ON. Perform the settings before performing installation and supplying power.
- · Properly set the DIP switch to match the item being counted (or measured) and use the DIP switch monitor for confirmation.



After setting the DIP switch for basic operations, advanced functions (\*) can be added using the operation keys. For details, refer to page 20.

Advanced functions consist of the decimal point position, prescale value, auto-zero time, startup time, display color, and key protect level.

When the H7BX using as a tachometer, switch to the tachometer configuration using the procedure given on page 23. **Settings for Advanced Functions** 

#### Settings that cannot be performed with the DIP switch are performed with the operation keys. Power ON Run mode For details on operations in run mode, refer to page 22. \*1. If the mode is switched to the function setting mode during operation, operation will continue. \*2. Changes made to settings in function setting mode are enabled for the first time when the mode is changed to run mode. Also, when settings are changed, the counter is automatically reset (measured values initialized and outputs turned OFF) on returning to run mode. MODE MODE The characters displayed in reverse video are the initial values. When performing settings with operation keys only, turn ON pin 1 of the DIP switch to OFF (factory setting). If pin 1 of the DIP switch is ON, the setting items indicated by \( \bullet \) will not be displayed. • Set the tachometer output mode with any of the Up Keys. tatn output mode (TOTM) MILō → RrER → HIHI → LŏLŏ -(AREA) (HI-HI) (LO-LO) (HI-LO) MODE Counting • Set the counting speed with any of the Up Keys. speed 30X E (CNTS) (10 kHz) MODE Decimal dP • Set the decimal point position with any of the Up Keys. point position (DP) (Two digits after decimal (One digit after decimal (Three digits after decimal MODE point) point) point) point) Prescale • Set the number for each digit with the Up Keys. value 1.000 (PSCL) →0.00 I $\sim$ <del>1.000</del> $\sim$ 99.999 : (0.001)(1.000) (99.999)MODE MODE Function setting mode Average Rub • Set the average processing with any of the Up Keys. processing (AVG) OFF ōFF. 2 -(No average processing) (Average of 2 (Average of 4 (Average of 8 MODE processing) measurements) measurements) measurements) RUEE Auto-zero • Set the number for each digit with the (Up) Keys. 99.9 (AUTZ) → 0.1 ~ **39.9** -(0.1 s) (99.9 s) MODE Stär Startup • Set the number for each digit with the Up Keys. time (STMR) 0.0 →**8.8** ~ 99.9 -(0.0 s) (99.9 s) MODE NPN/PNP • Set the NPN/PNP input mode with any of the Up Keys. ruod input mode (IMOD) npn (PNP input) MODE input) [ālr Display • Set the display color with any of the Up Keys. color (COLR) r E d $r \in S_{S_1} \to S_{C_1} \to S_{C_2} \to$ (Red) (Green) (Red-green) (Green-red) MODE • Set the key protect level with any of the Up Keys. Key protect level 4P - 1 (KYPT) $\rightarrow$ $\nu\rho$ -2 $\rightarrow$ $\nu\rho$ -3 $\rightarrow$ $\nu\rho$ -4 $\rightarrow$ $\nu\rho$ -5 -(KP-1) (KP-2) (KP-3) (KP-4) (KP-5)

### **Explanation of Functions**

Settings marked with a star can be performed with the DIP switch.

#### • Tachometer Output Mode (ŁŏŁň) ★

Set the output method for control output based on the OUT1/OUT2 set value. Upper and lower limit (HI-LO), area (AREA), upper limit (HI-HI), and lower limit (LO-LO) can be set.

(For details on the operation of the output modes, refer to *Output Mode Settings* on page 22.)

#### • Counting Speed (Ent5) ★

Set the maximum counting speed (30 Hz/10 kHz) for CP1 input. If contacts are used for input signals, set the counting speed to 30 Hz. Processing to eliminate chattering is performed for this setting.

#### • Decimal Point Position (dP)

Decide the decimal point position for the measurement value, OUT1 set value, and OUT2 set value.

#### • Prescale Value (PS[L)

It is possible to display the rate of rotation or the speed of a device or machine to which the H7BX is mounted by converting input pulses to a desired unit. If this prescaling function is not used, the input frequency (Hz) will be displayed.

The relationship between display and input is determined by the following equation. Set the prescale value according to the unit to be displayed.

Displayed value =  $f \times \alpha$ 

- f: Input pulse frequency (number of pulses in 1 second)
- α: Prescale value

#### 1. Displaying the Rotation Rate

Display unit	Prescale value (α)
rpm	1/N × 60
rps	1/N

N: Number of pulses per revolution

Example: In order to display the rate of rotation for a machine that outputs 5 pulses per revolution in the form \( \subseteq \subseteq \). \( \subseteq \text{rpm:} \)


- 1. Set the decimal point position to 1 decimal place.
- 2. Using the formula, set the prescale value to  $1/N \times 60 = 60/5 = 12$ .

#### 2. Displaying the Speed

Display unit	Prescale value (α)	
m/min	$\pi d \times 1/N \times 60$	
m/s	$\pi d \times 1/N$	

N: Number of pulses per revolution

- d: Diameter of rotating body (m)
- $\pi d$ : Circumference (m)

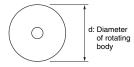

Note: Incorrectly setting the prescale value will result in counting errors. Check that the setting has been performed correctly before using the H7BX.

#### • Average Processing (ฅฃ๘) ★

\_\_\_\_\_

Flickering display and output chattering can be prevented by using average processing (simple averaging). Average processing can be set to one of four levels: no average processing, 2 times (i.e., the average of 2 measurement values), 4 times, or 8 times.

The measurement cycle will be equal to the sampling cycle (200 ms)

multiplied by the average processing setting (i.e., the number of times). Average processing enables fluctuating input signals to be displayed stably. Set the optimum number of times for the application.


#### • Auto-zero Time (Aut) ★

It is possible to set the H7BX so that if there is no pulse for a certain time the display is force-set to 0. This time is called the auto-zero time. Set the auto-zero time to a time slightly longer than the estimated interval between input pulses. It will not be possible to make accurate measurements if the auto-zero time is set to a time shorter than the input pulse cycle. Setting a time that is too long may also result in problems, such as a time-lag between rotation stopping and the alarm turning ON.

#### • Startup Time (5knc)

In order to prevent undesired output resulting from unstable input immediately after the power supply is turned ON, it is possible to prohibit measurement for a set time. This time is called the startup time.

It can also be used to stop measurement and disable output until the rotating body reaches the normal rate of rotation, after the power supply to the H7BX and rotating body are turned ON at the same time.

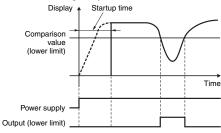

#### • NPN/PNP Input Mode (Lňod) ★

Select either NPN input (no-voltage input) or PNP input (voltage input) as the input format. Select an NPN input when using a 2-wire sensor. The same setting is used for all external inputs.

For details on input connections, refer to Input Connections on page 6.

#### • Display Color (LoLr)

Set the color used for the measurement value.

	Control output OFF	Control output ON	
rEd	Re	d (fixed)	
Gra	Gre	en (fixed)	
r-6 *1	Measured value displayed in red when both control outputs 1 and 2 are OFF.	Measured value displayed in green when either control output 1 or control output 2 is ON.	
<b>ũ-r</b> *2	Measured value displayed in green when both control outputs 1 and 2 are OFF.	Measured value displayed in red when either control output 1 or control output 2 is ON.	


- \*1. If the tachometer output mode is set to AREA, however, the measured value is displayed in red when control output 1 is OFF and in green when control output 1 is ON.
- \*2. If the tachometer output mode is set to AREA, however, the measured value is displayed in green when control output 1 is OFF and in red when control output 1 is ON.

#### • Key Protect Level (PYPL)


Set the key protect level.

For details, refer to Key Protect Level on page 24.

### **Operation in Run Mode**

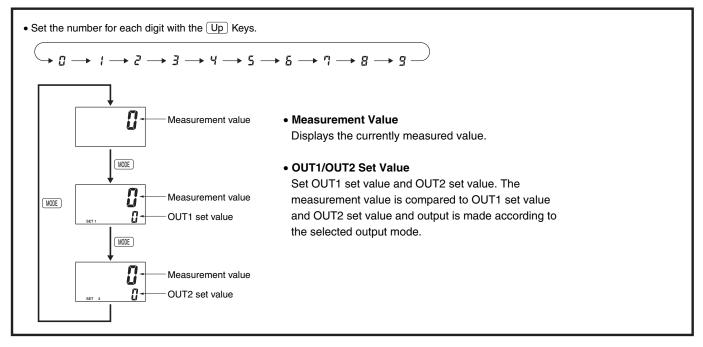



## **Output Mode Settings**

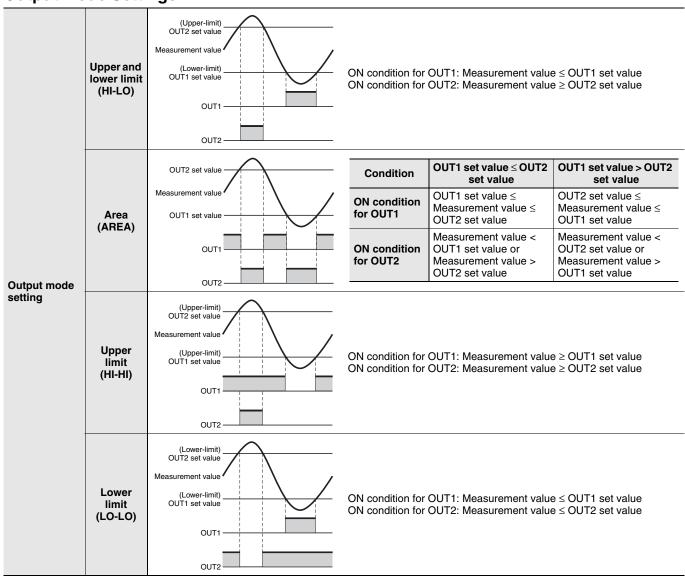

## Switching between Using a Preset Counter, Total and Preset Counter, Batch Counter, Dual Counter, and Tachometer

Select which H7BX configuration to use (i.e., preset counter, total and preset counter, batch counter, dual counter, or tachometer) in the configuration selection mode. The H7BX is also equipped with a DIP switch monitor function, a convenient function that enables the settings of the DIP switch pins to be confirmed using the front display.

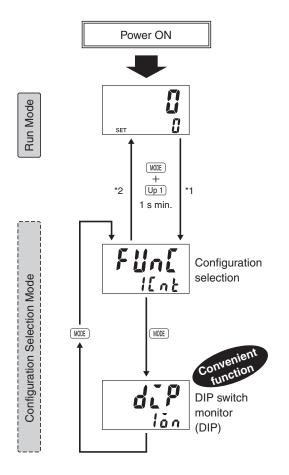

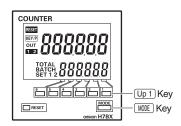

#### Caution

To change the mode to configuration selection mode, press the Up 1 Key for 1 s min. with the key held down.

The mode will not change if the Up 1 Key is pressed first.


Select the configuration with any of the Up Keys.

Note: 1. The configuration that can be selected depend on the model.

The default setting is for a 1-stage preset counter. (For models with a 2-stage setting, the default is for a 2-stage preset counter.)

The status of the DIP switch pins (1 to 8) can be confirmed using the Up Keys.

Note: This display is possible only if DIP switch pin 1 (DIP switch settings) is set to ON (i.e., enabled).

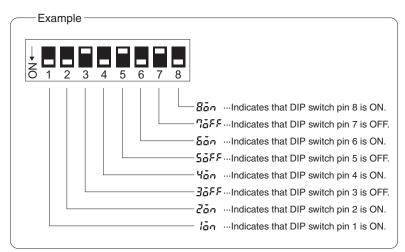


- \*1. When the mode is changed to configuration selection mode, the present value is reset, outputs turns OFF, and counting (measuring) stops.
- \*2. Setting changes made in configuration selection mode are enabled when the mode is changed to run mode.

  If the configuration is changed, the set value (or set value 1 and set value 2), OUT1 set value or OUT2 set value are initialized.

### **Key Protect Level**

When the key-protect switch is set to ON, it is possible to prevent setting errors by prohibiting the use of certain operation keys by specifying the key protect level (KP-1 to KP-5). The key protect indicator is lit while the key-protect switch is set to ON. Confirm the ON/OFF status of the key protect switch after the H7BX is mounted to the panel.

Key protection is enable by short-circuited key protection terminals.

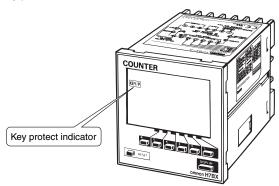

		Details			
Level	Meaning	Changing mode (See note.)	Switching display in run mode	Reset Key	Up/Down Keys (Up Keys for 6-digit models)
KP-1 (default setting)	neset MODE oneon H78X	No	Yes	Yes	Yes
KP-2	neset Green H78X	No	Yes	No	Yes
KP-3	PRESET ORIGINATION OF THE PROPERTY OF THE PROP	No	Yes	Yes	No
KP-4	TRESET ORIGINATION OF THE PROPERTY OF THE PROP	No	Yes	No	No
KP-5	TRESET ORIGINATION AT THE PROPERTY OF THE PROP	No	No	No	No

Note: Changing to configuration selection mode and function selection mode.

## **Self-diagnostic Function**

The following displays will appear if an error occurs.

Main display	Sub-display	Error	Output status	Correction method	Set value after reset
*1	No change	Present value underflow *2	No change	Either press the Reset Key or turn ON reset input.	No change
FFFFF *1	No change	Present value overflow *3	No change	Either press the Reset Key or turn ON reset input. *4	No change
EI	Not lit	CPU	OFF	Either press the Reset Key or reset the power supply.	No change
53	Not lit	Memory error (RAM)	OFF	Reset the power supply.	No change
£2	SUĀ	Memory error (EEP) *5	OFF	Reset to the factory settings using the Reset Key.	0

<sup>\*1.</sup> Display flashes (1-second cycles).

<sup>\*2.</sup> Occurs when the present value or the total count value goes below –99,999

<sup>\*3.</sup> Occurs when the present value reaches 999,999 under the following conditions:

<sup>•</sup> The output mode is K-2, D, L, or H.

<sup>•</sup> The H7BX is set for dual counter operation.

<sup>\*4.</sup> Except when the H7BX is used as a tachometer.

<sup>\*5.</sup> Includes the case where the EEPROM has reached its overwrite lifetime.

## **Safety Precautions**

Refer to Safety Precautions for All Counters.

#### 

Minor injury due to electric shock may occasionally occur. Do not touch any of the terminals while power is being supplied.



Fire may occasionally occur. Tighten the terminal screws to a torque of 0.5 to 0.6 N·m (4.4 to 5.3 in-lb).



Minor injury due to explosion may occasionally occur. Do not use the H7BX where subject to flammable or explosive gas.



If the output relay is used beyond its life expectancy, its contacts may become fused or there may be a risk of fire.



Use the output relay within its rated load and electrical life expectancy. The life expectancy of the output relay varies considerably according to its usage.

Minor electric shock, fire, or malfunction may occasionally occur. Never attempt to disassemble, modify, or repair the H7BX or touch any of the internal parts.



#### **Precautions for Safe Use**

#### **Operating Environment**

- The H7BX is intended for indoor use only. Do not use the H7BX outdoors or in any of the following locations.
  - $\bullet$  Locations subject to sudden or extreme changes in temperature.
  - Locations where high humidity may result in condensation.
  - Locations subject to direct sunlight.
  - Locations subject to corrosive gas.
  - Locations subject to excessive dust or dirt.
- This is a class A product (for industrial environments). In residential
  areas, it may cause radio interference, in which case the user may
  be required to take adequate measures to reduce interference.
- Use the H7BX within the specified ratings for operating temperature and humidity. Temperature rise may shorten the service life of H7BX if it is used near a power supply or other heat-generating objects.
- Use the H7BX within the specified ratings for vibration, shock, and splashing water.
- The H7BX is not oil resistant. Do not use it in locations subject to oil.
- Install the H7BX well away from any sources of excessive static electricity, such as pipes transporting molding materials, power, or liquids.
- Store the H7BX within the specified ratings. If the H7BX has been stored at temperatures of –10°C or lower, let it stand for 3 hours or longer at room temperature before turning ON the power supply.

#### Power Supply

- Maintain voltage fluctuations in the power supply within the specified range.
- Internal elements may be destroyed if a voltage beyond the rated voltage is applied.
- When the power is turned ON, an inrush current will flow for a short time (approx. 10 A for 2 ms). Depending on the power supply capacity, operation may not start. Be sure to use a power supply with a sufficient capacity.

- Use a commercial power supply as the AC power supply for the H7BX. Using an inverter output with an output frequency of 50/60 Hz as the power supply may cause the H7BX to produce smoke or become damaged by burning.
- Use a switch, relay, or other device with contacts so that the rated power supply voltage will be reached within 2 s. If the power supply voltage is not reached quickly enough, the outputs may malfunction.
- Use a switch, relay, or other device with contacts so that the rated power supply voltage will be reached within 2 s. If the power supply voltage is not reached quickly enough, the outputs may malfunction.

#### Installation and Wiring


- To mount the H7BX to a panel, attach the two supplied adapters to the left and right sides of the H7BX, and securely tighten the knurled screws on the adapters by hand, maintaining a balance between them. Damage may result if the knurled screws are excessively tightened with pliers or other tools.
- Be sure to wire the terminals correctly.
- Up to two wires of the same size and type can be inserted into a single terminal.
- Do not connect more than two crimp terminals to each H7BX terminal.
- Use the specified wires for wiring.
   Applicable wire: AWG 24 to AWG 18 (equal to a cross-sectional area of 0.20 to 0.82 mm²)
   Solid wire or twisted wire (copper), operating temperature over 70°C.
- Separate the H7BX, the devices that generate input signals, and input signal wires from any potential sources of noise, such as high-voltage lines.

#### Handling


- Do not use organic solvents (such as paint thinner or benzine), strong alkaline, or strong acids because they will damage the external finish
- Approximately 14 V will be output to the input terminals when the H7BX is used with the key protection input terminals and no-voltage input (NPN input) is used. To prevent charging accidents, connect a diode to the power supply circuit of input devices if input devices are used with a power supply of less than 14 V.
- Do not connect loads that exceed the rated output current. The output elements may be destroyed, possibly resulting in short-circuit or open-circuit faults.
- When using heaters, be sure to use a thermal switch for the load circuit.
- Always connect a diode to protect against counter electromotive force when using an inductive load. H7BX electromotive force may destroy output elements, possibly resulting in short-circuit or open-circuit faults.
- Install a switch or circuit breaker that allows the operator to immediately turn OFF the power, and label it to clearly indicate its function.
- Check that the display (backlight and LCD) is operating normally.
   Some operating environments may accelerate deterioration of the indicators, LCD, and resin components and cause display malfunctions. Periodically inspect and replace parts.

#### **Precautions for Correct Use**

- Inrush current generated by turning ON or OFF the power supply may deteriorate contacts in the power supply circuit. Turn ON or OFF using a device with a rated current of 10 A or higher.
- Input signals may be accepted, not accepted, or unstable for the following time when the power supply is turned ON or OFF. Set the system to allow leeway in the timing of input signals.

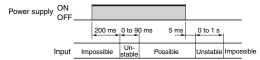

- This H7BX always compares the count value with the set value.
   Thus, if you change the set value during operation, please remember that the output will turn ON when the set value becomes equal to the count value.
- With the factory setting, the output will turn ON when power is supplied to the H7BX because the set value and count value are both zero. While resetting, however, the output stays OFF.
- EEPROM is used as memory when the power is interrupted. The write life of the EEPROM is 100,000 writes. The EEPROM is written when settings are changed, or the power is tuned OFF.
- Water resistance will be lost if the front sheet is peeled off or torn.
   Do not use the H7BX if the front sheet is missing or torn.
- Abide by all local ordinances and regulations when disposing of the H7BX.
- External Power Supply
  Reduce the load current as shown in the diagram on the right
  according to the power supply voltage if a DC power supply is used
  for models specified for 24 VAC/12 to 24 VDC.

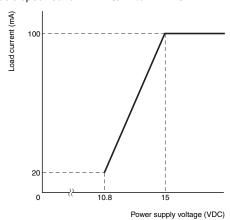

#### Terms and Conditions Agreement

#### Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

#### Warranties.

- (a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.
- (b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE

PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warrantv.

See <a href="http://www.omron.com/global/">http://www.omron.com/global/</a> or contact your Omron representative for published information.

#### Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

#### Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

#### Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

#### Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

#### Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

Errors and Omissions. Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical or proofreading errors or omissions.

2018.6

In the interest of product improvement, specifications are subject to change without notice.



## **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

## Omron:

Y92A-72T H7BX-AW AC100-240 H7BX-AWD1 AC24/DC12-24 H7BX-A AC100-240 H7BX-AD1 AC24/DC12-24

## **ПОСТАВКА** ЭЛЕКТРОННЫХ КОМПОНЕНТОВ

Общество с ограниченной ответственностью «МосЧип» ИНН 7719860671 / КПП 771901001 Адрес: 105318, г.Москва, ул.Щербаковская д.3, офис 1107

# Данный компонент на территории Российской Федерации Вы можете приобрести в компании MosChip.

Для оперативного оформления запроса Вам необходимо перейти по данной ссылке:

#### http://moschip.ru/get-element

Вы можете разместить у нас заказ для любого Вашего проекта, будь то серийное производство или разработка единичного прибора.

В нашем ассортименте представлены ведущие мировые производители активных и пассивных электронных компонентов.

Нашей специализацией является поставка электронной компонентной базы двойного назначения, продукции таких производителей как XILINX, Intel (ex.ALTERA), Vicor, Microchip, Texas Instruments, Analog Devices, Mini-Circuits, Amphenol, Glenair.

Сотрудничество с глобальными дистрибьюторами электронных компонентов, предоставляет возможность заказывать и получать с международных складов практически любой перечень компонентов в оптимальные для Вас сроки.

На всех этапах разработки и производства наши партнеры могут получить квалифицированную поддержку опытных инженеров.

Система менеджмента качества компании отвечает требованиям в соответствии с ГОСТ Р ИСО 9001, ГОСТ РВ 0015-002 и ЭС РД 009

#### Офис по работе с юридическими лицами:

105318, г. Москва, ул. Щербаковская д. 3, офис 1107, 1118, ДЦ «Щербаковский»

Телефон: +7 495 668-12-70 (многоканальный)

Факс: +7 495 668-12-70 (доб.304)

E-mail: info@moschip.ru

Skype отдела продаж:

moschip.ru\_6 moschip.ru\_4 moschip.ru\_9