

Figure 1


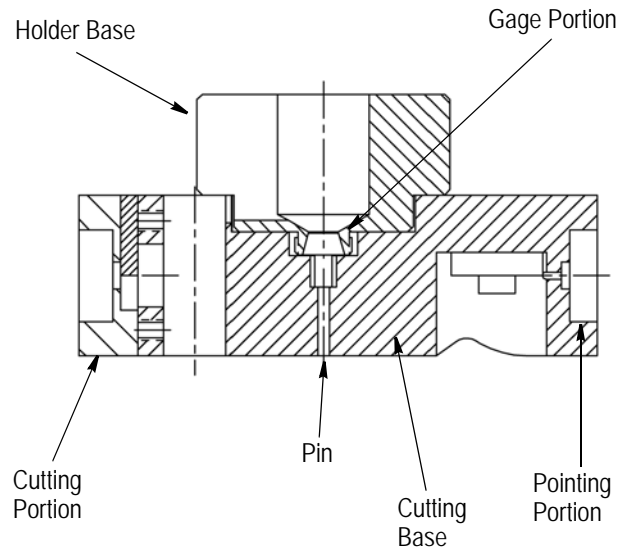


Figure 2

1. INTRODUCTION

(Non-adjustable) Hand Trim and Pointing Tool 1055815-1 was designed to cut the insulation on RG-405/U (0.085-inch) coaxial cable and "point" the center conductor of the stripped coaxial cable.



Dimensions are in metric units [with U.S. customary units in brackets] unless otherwise designated.

Refer to Section 5, REVISION SUMMARY, for updates.

2. DESCRIPTION


This tool is shipped in kit form and consists of the holder base, the cutting base, and the cutter set gage. Refer to Figure 1 and Figure 4. The kit also contains two hex wrenches.

3. OPERATION

1. Seat the holder base onto the gage portion of the cutting base.
2. Insert the cable into the holder base until the cable makes contact with the pin of the gage. See Figure 2.
3. Firmly turn the holder base clockwise to tighten it.
4. Remove the holder base and insert it into the cutting portion of the cutting base.
5. Rotate the holder base clockwise and apply a light axial force to start the cut.

6. Continue rotating the cutting base until you can no longer feel resisting cutting force. (This indicates that the cutting/trimming portion of the operation is complete.)

7. Remove the cutting base from the holder base.



The center conductor should now be exposed.


8. Insert the holder base into the pointing portion of the cutting base.

9. With the cable still in the holder base, turn the cutting base clockwise four or five times while applying axial pressure.


10. Remove holder base from the pointing portion of the cutting base and re-insert it into the gage portion.

11. Turn the holder base approximately 1/2 turn counterclockwise to loosen it.

12. Remove the cable. The cable has now been trimmed and pointed to the dimensions shown in Figure 3.



If the length of the cable center conductor is shorter than .065 inches for RG-405/U cable, the tool may not be able to adequately point the cable center conductor.

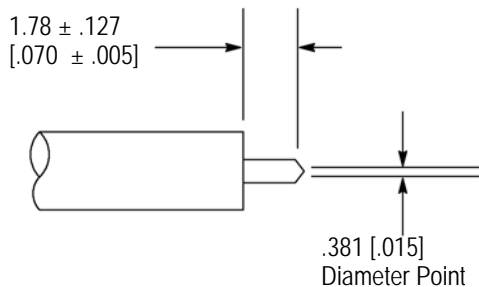

RG-405/U Cable

Figure 3

4. CUTTER ADJUSTMENT OR REPLACEMENT

4.1. Cutter Adjustment


The trim and pointing tool is already adjusted for most kinds of semi-rigid coaxial cable. However, if adjustment becomes necessary, proceed as follows:

1. Assemble the set gage in the holding base, as if it were a cable.

2. Loosen the .050-hex, set screw and retract the cutter slightly.

3. Put holder base/cutting gage assembly into the cutting portion of the cutting base.


4. Push the the cutting blade into the cutter set gage. Then tighten the set screw.



The slight changes in cutting depth are determined by by how hard the cutter is pushed.

4.2. Cutter Replacement

If the pointing cutter becomes dull, remove the holding screw and remove the insert. Reposition the insert so a new cutting edge rests against the tool.



There are six cutting edges per insert.

5. REVISION SUMMARY

Revisions to this instruction sheet include:

- Changed company name and logo

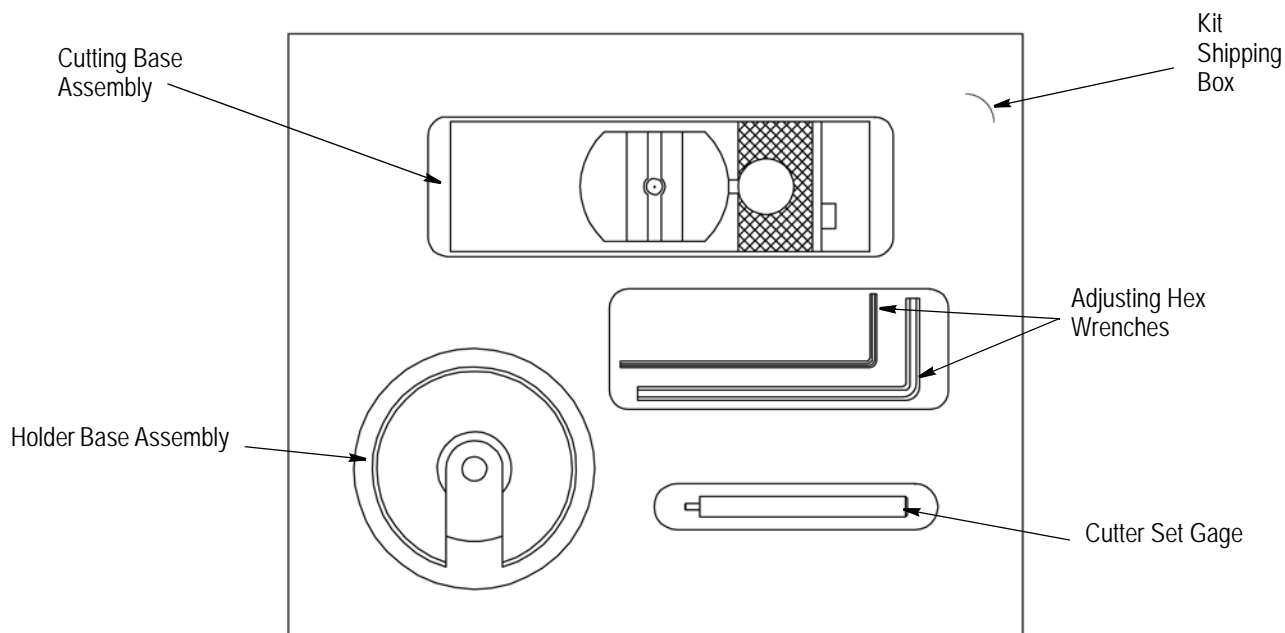


Figure 4

Данный компонент на территории Российской Федерации

Вы можете приобрести в компании MosChip.

Для оперативного оформления запроса Вам необходимо перейти по данной ссылке:

<http://moschip.ru/get-element>

Вы можете разместить у нас заказ для любого Вашего проекта, будь то серийное производство или разработка единичного прибора.

В нашем ассортименте представлены ведущие мировые производители активных и пассивных электронных компонентов.

Нашей специализацией является поставка электронной компонентной базы двойного назначения, продукции таких производителей как XILINX, Intel (ex.ALTERA), Vicor, Microchip, Texas Instruments, Analog Devices, Mini-Circuits, Amphenol, Glenair.

Сотрудничество с глобальными дистрибьюторами электронных компонентов, предоставляет возможность заказывать и получать с международных складов практически любой перечень компонентов в оптимальные для Вас сроки.

На всех этапах разработки и производства наши партнеры могут получить квалифицированную поддержку опытных инженеров.

Система менеджмента качества компании отвечает требованиям в соответствии с ГОСТ Р ИСО 9001, ГОСТ РВ 0015-002 и ЭС РД 009

Офис по работе с юридическими лицами:

105318, г.Москва, ул.Щербаковская д.3, офис 1107, 1118, ДЦ «Щербаковский»

Телефон: +7 495 668-12-70 (многоканальный)

Факс: +7 495 668-12-70 (доб.304)

E-mail: info@moschip.ru

Skype отдела продаж:

moschip.ru

moschip.ru_4

moschip.ru_6

moschip.ru_9