

Instructions for Assembly of the Mini-Delta Ribbon Wiremount Socket Connector to .050" Flat Cable

Instructions for the Assembly of the Mini-Delta Ribbon Wiremount Socket Connector to .050" Flat Cable using Model 10951 Harness Assembly Tool.

General:

The assembly tool 10951 was designed to aid in the assembly of the Wiremount Socket Connector in the Mini-Delta Ribbon family. This assembly tool is designed for positions 14, 20, 26, 36, 40, 50 and 68. The following set up and assembly instructions are based on termination procedures for harness assembly using the 10951 assembly tool.

Assembly Equipment:

The 10951 assembly tool is a unit package, designed with a sliding Locator Plate that is attached to the base of the press. Included with this unit is a platen and shut height gauge.

Refer to Figure 2 for steps 1-11

1. Slide the locator plate (F) toward the operator.
2. Unlatch both the right and left cable clamps (A) & (B), using the silver spring latches, and rotate each cable clamp to the back of the plate.
3. Set the four (4) cable guides (C), to the outer most position, two (2) to the front and two (2) to the back of the plate.

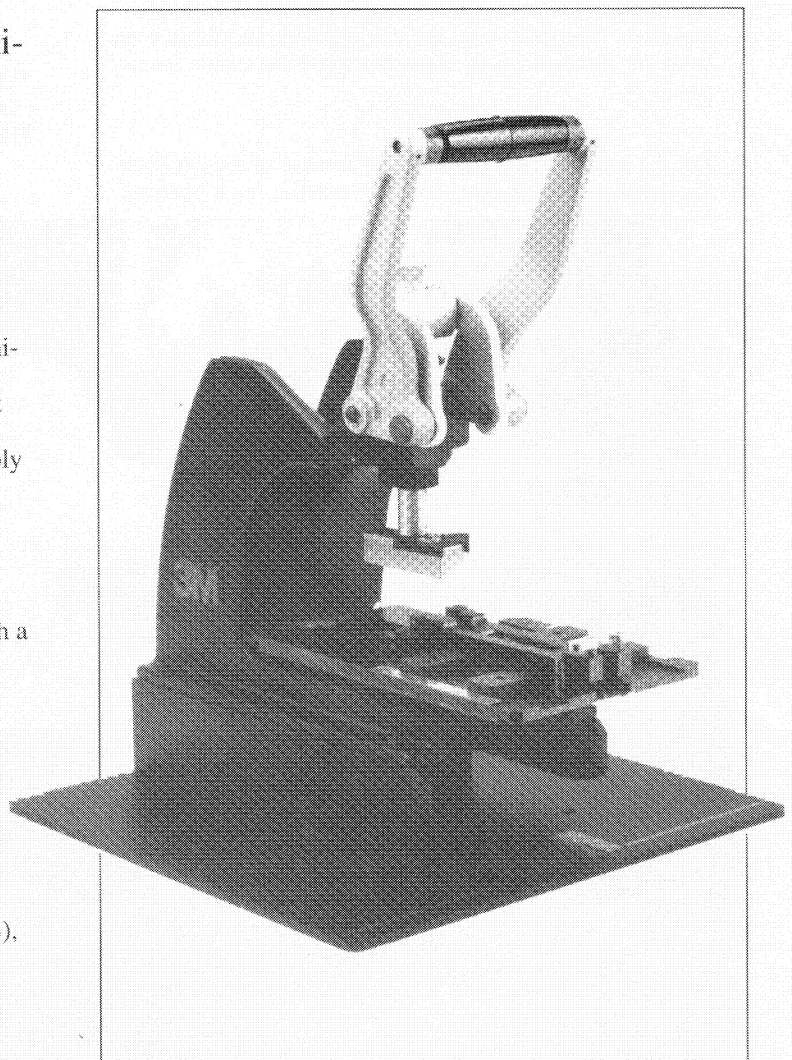


Figure 1

4. Slide the cover stop (D), to the back of the plate.
5. Place the shut height gauge (E), stored on the right side of the press, in the locator plate groove and between the cable guides. Slide the locator plate back into position so the shut height gauge is directly below the platen. Lower the press handle until the platen comes in contact with the shut height gauge. Adjust the knob on top of the tool until the platen is just contacting the locator plate when the handle is in its full downright position. Return the handle to the full upright position. Turn the adjustment knob clockwise one half revolution.
6. Slide the locator plate towards the operator and remove the shut height gauge. Store it back on the side of the press.
7. Move both the front and back cable guides (C), into position. The groove on the cable guides should line up with the corresponding connector position on the locator plate (F).
8. Put the cover of the connector to be assembled between the cable guides, making sure the smaller latch opening

is OPPOSITE the operator and against the front cable guide.

9. Slide the cover stop (D), forward until it rests against the back of the cover.
10. Rotate the right cable clamp (B), to the front and lock it down by turning the silver spring latch counter-clockwise. Set the connector end guide (G), located on the cable clamp so the back of the connector end guide is in line with the back of the rear cable guides. Unlatch the cable clamp and rotate it to the back.
11. Rotate the left cable clamp (A), to the front and lock it down by turning the silver spring latch clockwise. Align the outside of the connector guide (H), with the outside of the front cable guides. Unlatch the cable clamp and rotate it to the back.

NOTE: THE CHAMFERED (ANGLED) SIDE OF THE CONNECTOR GUIDES MUST BE FACING TOWARD THE INSIDE OF THE NEST.

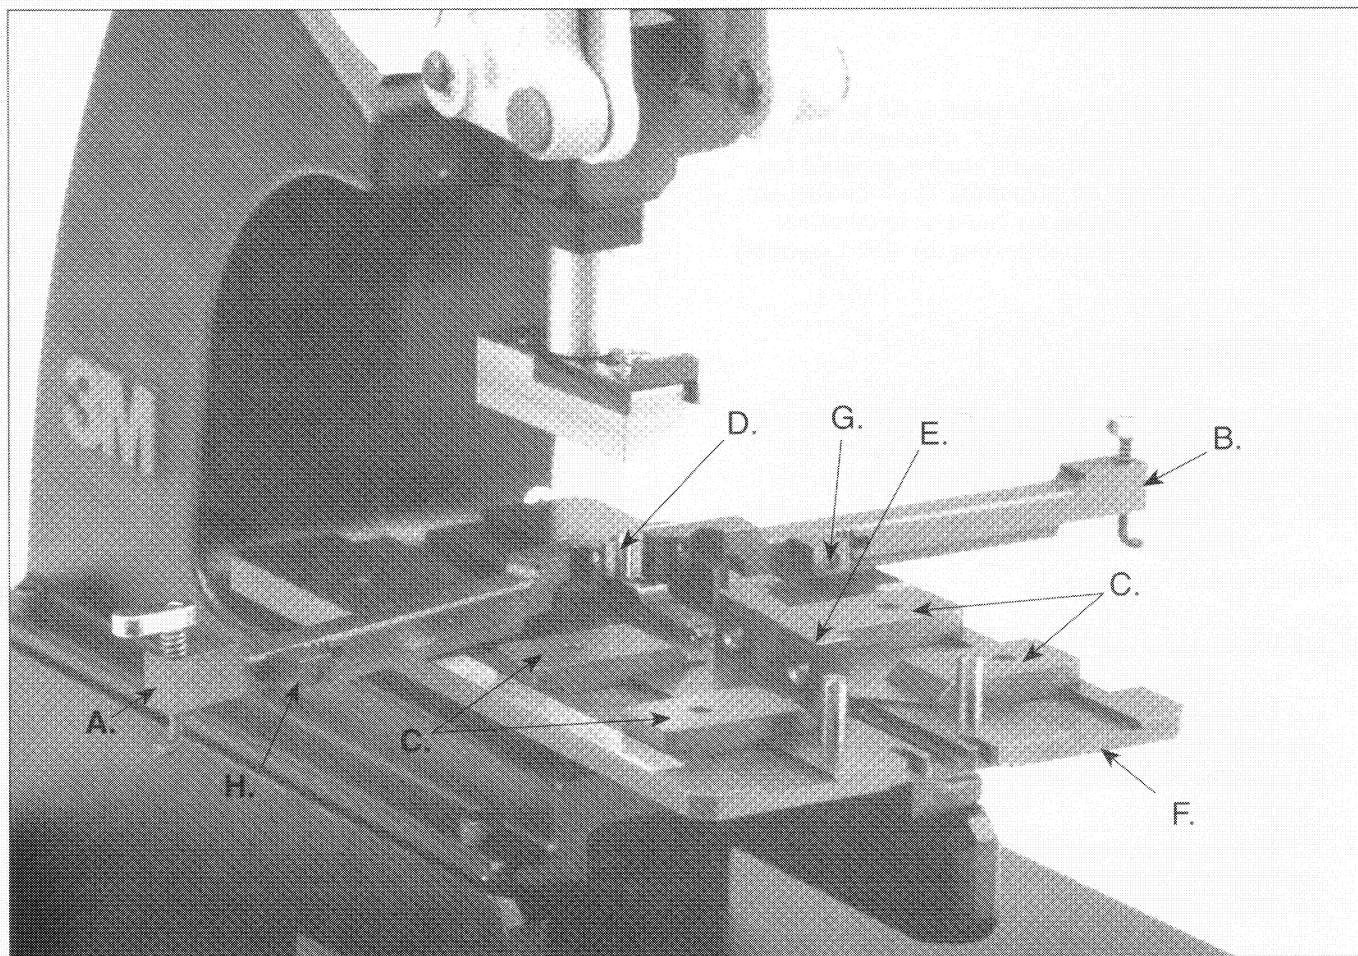


Figure 2

Assembly procedure

1. Place the two cables through the slots in the cover allow each cable to extend at least one (1) inch past the cover. Fold the extended portion of the cable 90 degrees allowing each cable to rest on the inside of the cover.

NOTE: The cable should enter the cover through the bottom (C of Fig. 3), with the extended portion exiting upwards and resting in the cable grooves.

2. With the narrow latch opening OPPOSITE the operator, insert the cable/cover sub-assembly into the cutout in the locator plate until the cover seats between the cable guides (D of Fig. 3).
3. Using the left hand to hold the cable/cover in place, rotate the right cable clamp, forward and lock it in position over the cable.
4. Repeat the same operation with the left cable clamp.
5. Place the connector body, with narrower connecting latch OPPOSITE the operator (E of Fig. 3), in the nest between the connector guides.
6. Push the locator plate away from the operator, back to the shuttle stop and in line under the platen.
7. Pull the press handle down completing the assembly.
8. Raise the press handle and pull the locator plate towards the operator.
9. Release the cable clamps and remove assembly from the nest.

NOTE: DO NOT DISTURB THE SETTINGS ON THE LOCATOR PLATE.

10. Inspect the harness assembly to insure both latches are latched. If not, place assembly back in the nest and adjust press down by rotating adjustment knob clockwise a quarter turn. Repeat steps 7-9.

NOTE: BOTH LATCHES HAVE TO BE COMPLETELY LATCHED TO MAKE A QUALITY TERMINATION.

Cable Cutter

To trim the excess cable from the assembly, use the cable cutter Model 10952. This tool is not included with the harness assembly tool and must be separately ordered.

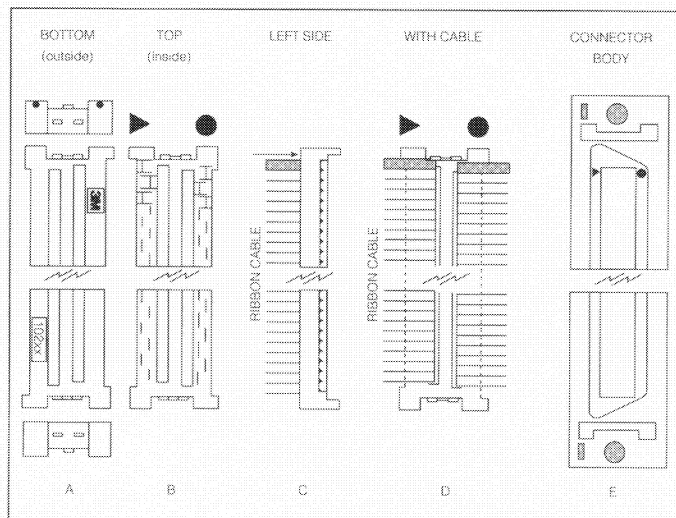


Figure 3

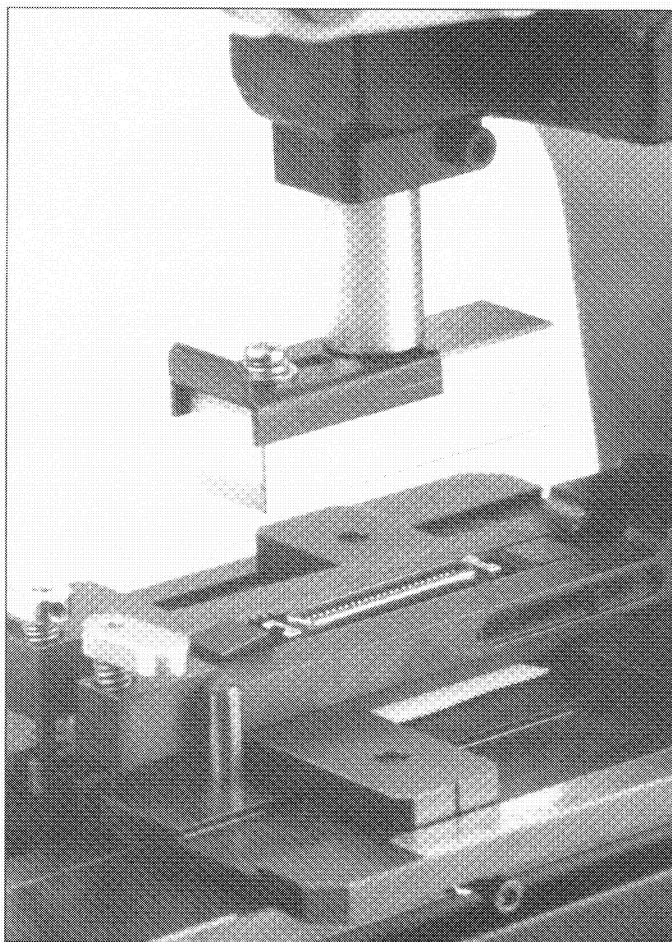


Figure 4

Call 800-328-7732

for technical product information

Important Notice

All statements, technical information and recommendations related to the Seller's products are based on information believed to be reliable, but the accuracy or completeness thereof is not guaranteed. Before utilizing the product, the user should determine the suitability of the product for its intended use. The user assumes all risks and liability whatsoever in connection with such use.

Any statements or recommendations of the Seller which are not contained in the Seller's current publications shall have no force or effect unless contained in an agreement signed by an authorized officer of the Seller. The statements contained herein are made in lieu of

Call 800-225-5373

for sales and ordering information

all warranties, express or implied, including but not limited to the implied warranties of merchantability and fitness for a particular purpose which warranties are hereby expressly disclaimed.

SELLER SHALL NOT BE LIABLE TO THE USER OR ANY OTHER PERSON UNDER ANY LEGAL THEORY, INCLUDING BUT NOT LIMITED TO NEGLIGENCE OR STRICT LIABILITY, FOR ANY INJURY OR FOR ANY DIRECT OR CONSEQUENTIAL DAMAGES SUSTAINED OR INCURRED BY REASON OF THE USE OF ANY OF THE SELLER'S PRODUCTS THAT WERE DEFECTIVE.

Innovation working for you™

3M Electronic Products Division

6801 River Place Blvd.
Austin, TX 78726-9000



Данный компонент на территории Российской Федерации

Вы можете приобрести в компании MosChip.

Для оперативного оформления запроса Вам необходимо перейти по данной ссылке:

<http://moschip.ru/get-element>

Вы можете разместить у нас заказ для любого Вашего проекта, будь то серийное производство или разработка единичного прибора.

В нашем ассортименте представлены ведущие мировые производители активных и пассивных электронных компонентов.

Нашей специализацией является поставка электронной компонентной базы двойного назначения, продукции таких производителей как XILINX, Intel (ex.ALTERA), Vicor, Microchip, Texas Instruments, Analog Devices, Mini-Circuits, Amphenol, Glenair.

Сотрудничество с глобальными дистрибьюторами электронных компонентов, предоставляет возможность заказывать и получать с международных складов практически любой перечень компонентов в оптимальные для Вас сроки.

На всех этапах разработки и производства наши партнеры могут получить квалифицированную поддержку опытных инженеров.

Система менеджмента качества компании отвечает требованиям в соответствии с ГОСТ Р ИСО 9001, ГОСТ РВ 0015-002 и ЭС РД 009

Офис по работе с юридическими лицами:

105318, г.Москва, ул.Щербаковская д.3, офис 1107, 1118, ДЦ «Щербаковский»

Телефон: +7 495 668-12-70 (многоканальный)

Факс: +7 495 668-12-70 (доб.304)

E-mail: info@moschip.ru

Skype отдела продаж:

moschip.ru

moschip.ru_4

moschip.ru_6

moschip.ru_9